Building Enclosure Repairs - 4 Buildings Mott High School, Kettering High School, Crary Campus, Kingsley Montgomery School Waterford, Michigan





MOTT HIGH SCHOOL 1151 SCOTT LAKE RD, WATERFORD TWP, MI 48328





CRARY CAMPUS 501 N CASS LAKE RD, WATERFORD TWP, MI 48328

ENGINEER


SME 43980 PLYMOUTH OAKS BLVD. PLYMOUTH, MI 48170 (734) 454-9900 CONTACT: MR. KYLE DAMEROW, PE

APPLICABLE CODES

2015 MICHIGAN REHABILITATION BU

<u>OWNER</u>

WATERFORD SCHOOL DISTRICT 501 NORTH CASS LAKE ROAD. WATERFORD, MI 48328 CONTACT: MR. SIDNEY TIPPETT (248) 613-4426

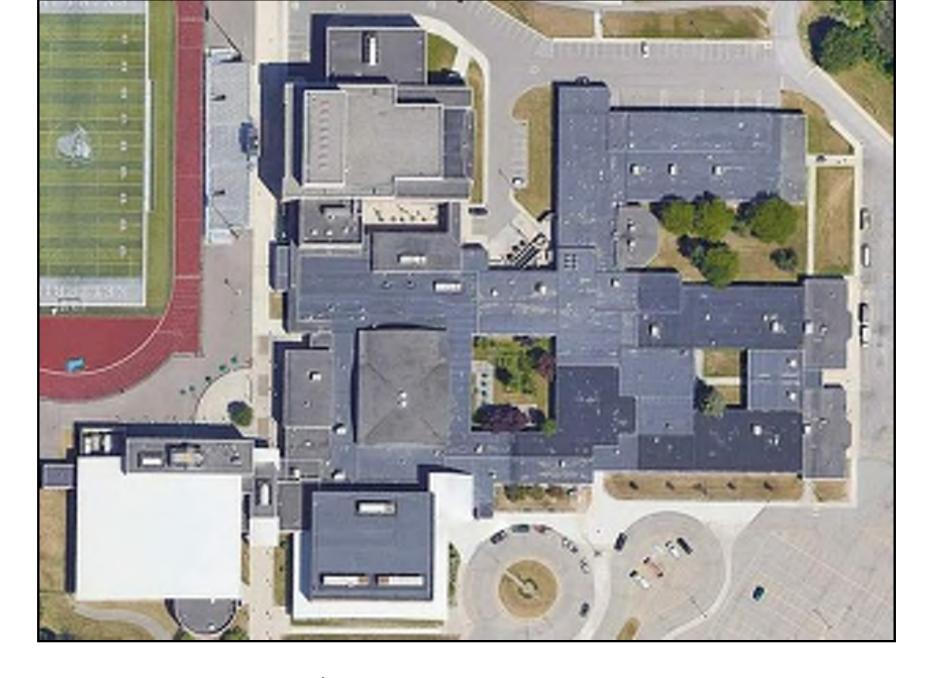



KETTERING HIGH SCHOOL 2800 KETTERING DR, WATERFORD TWP, MI 48329





KINGSLEY MONTGOMERY SCHOOL 4265 HALKIRK DR, WATERFORD TWP, MI 48329

GENERAL NOTES:

1.THE SUMMARY OF WORK CONTAINE AND ACTIVITIES NECESSARY TO COM PROVIDE THE DESIRED WORK RESUL COMPLETE THE WORK AT NO ADDITION

2.ASSUME SOLE AND COMPLETE RES OF PROPERTY AND PEDESTRIANS. PE AND FEDERAL SAFETY AND HEALTH S

3.PROVIDE TEMPORARY PROTECTION PROTECT THE PEDESTRIAN AND VEH

4.PROVIDE TEMPORARY PROTECTION NEEDED DURING THE WORK TO PREV PROVIDE TARPAULINS OR PLASTIC SH CONSTRUCTION.

5.PROVIDE TEMPORARY PROTECTION SATISFYING OWNER'S REQUIREMENT GROUNDS DAMAGED DURING THE WO BY THE OWNER. DAMAGED EQUIPMEN

6.PROVIDE TEMPORARY PROTECTION USE OR OTHER EQUIPMENT. RESTOR

7.NOTIFY THE OWNER AND ENGINEER OF ACTIVITIES. THE GENERAL REPAIR BE DETERMINED IN THE FIELD BY THE

8.PROMPTLY REPORT UNANTICIPATE ADVERSELY IMPACT THE WORK TO T

9.MAINTAIN AN UP-TO-DATE SET OF P RECORDS OF CHANGES TO THE WOR EXISTING OR CONSTRUCTED CONDIT ON A SET OF DRAWINGS TO BE PROV

10.FOLLOW MANUFACTURER'S RECOM APPLICATION AND CURING OF MATER

11.SECURE SITE STAGING AREA FOR

12.STORAGE OF MATERIALS INSIDE T ROOFS OR IN THE STAGING AREA. RE THE END OF EACH WORK DAY.

13.TAKE DUE CARE AND CAUTION TO THE CONSTRUCTION ZONE. REMOVE SOON AS POSSIBLE, AT NO ADDITION THE END OF EACH WORK DAY AND TA INCLUDES DEBRIS FROM THE CONTRA


14.REMOVE WASTE MATERIALS AND D IN A LEGAL MANNER.

15.REMOVE STAINING / CONTAMINAN SMEARED SEALANTS, BITUMINOUS M EQUIPMENT USED ON SITE.


16.CLEAN AND RESTORE DISTURBED BLANKETS. LEGALLY DISPOSE OF DEP


17.UPON COMPLETION OF THE WORK RESTORE DISTURBED AREAS TO THE


	SHEET NO.	SHEET TITLE	
	CS1	COVER SHEET	SME
	A1.1	MOTT HIGH SCHOOL ENCLOSURE REPAIR PLAN	
	A1.2	MOTT HIGH SCHOOL ENCLOSURE REPAIR CONDITIONS	www.sme-usa.com
	A1.3	MOTT HIGH SCHOOL SEALANT REPAIR PLAN	
E	A1.4	MOTT HIGH SCHOOL SEALANT REPAIR CONDITIONS	· · · · · · · · · · · · · · · · · · ·
	A1.5	MOTT HIGH SCHOOL FLASHING HEIGHT ADJUSTMENT PLAN	
	A2.1	KETTERING HIGH SCHOOL ENCLOSURE REPAIR PLAN	
UILDING CODE		KETTERING HIGH SCHOOL ENCLOSURE REPAIR	
OILDING CODE	A2.2	CONDITIONS	DRAWING NOTE: SCALE DEPICTED IS MEANT FOR 24" X 36" AND WILL SCALE INCORRECTLY IF
	A2.3	KETTERING HIGH SCHOOL FLASHING HEIGHT ADJUSTMENT PLAN	PRINTED ON ANY OTHER SIZE MEDIA
	A3.1	CRARY CAMPUS ENCLOSURE REPAIR PLAN	
	A3.2	CRARY CAMPUS SEALANT REPAIR PLAN	
	A3.3	CRARY CAMPUS ENCLOSURE AND SEALANT REPAIR	
		CONDITIONS	
	A4.1	KINGSLEY MONTGOMERY SCHOOL SEALANT REPAIR PLAN	WATERFORD SCHOOL DISTRICT
		KINGSLEY MONTGOMERY SCHOOL SEALANT REPAIR	BUILDING ENCLOSURE
	A4.2	CONDITIONS	REPAIRS - 4 BUILDINGS
	A5.1	DETAILS	
	A5.2	DETAILS	
			-
MPLETE WORK REQUI JLT, IN ADDITION TO TH IONAL COST TO THE C	RED FOR THE TE REQUIREMI WNER. B SITE CONDIT	N THE PLANS MAY NOT INCLUDE ALL ITEMS REPAIRS. TAKE REASONABLE MEASURES TO ENTS SHOWN IN THE DRAWINGS, TO FIONS, INCLUDING SAFETY AND PROTECTION /ICES IN COMPLIANCE WITH LOCAL, STATE,	WATERFORD TWP, MI
STANDARDS, LAWS, A	ND REGULATI	ONS.	Sheet Name
		CTURES AND OTHER MEASURES NEEDED TO D IN THE VICINITY OF THE WORK AREA.	COVER SHEET
EVENT LEAKS INTO TH	E BUILDING AN	R BLOCKS, AND INTERIOR PROTECTION ID WATER DAMAGE TO THE INTERIOR. CTION INSIDE THE BUILDING DURING	
ITS. RESTORE EXISTIN VORK TO ORIGINAL CC	IG EQUIPMENT	NG, AND SITE DURING THE WORK, , BUILDING COMPONENTS, SIDEWALK, AND EPLACE WITH NEW MATERIALS AS DIRECTED CED AT NO COST TO THE OWNER.	Engineer's Seal
	-	IENTS AGAINST BREAKAGE DUE TO MANLIFT EMENTS TO PRE-PROJECT CONDITIONS.	
ER OF ANTICIPATED CH	HANGES OR AL	DDITIONS TO THE WORK PRIOR TO THE START	
HE CONTRACTOR AND	APPROVED B		
THE OWNER AND ENG	INEER FOR AD	VISEMENT.	
RK THAT OCCUR DURI	ING CONSTRU	SITE. KEEP ACCURATE AND LEGIBLE CTION AND INFORMATION ON 'AS-BUILT' S AND AS-BUILT CONDITIONS DOCUMENTED RUCTION COMPLETION.	Revisions REV ISSUED FOR DATE BY OWNER REVIEW 12/22/23 AKC BID 1/16/24 KMD
OMMENDATIONS FOR I	,	DRAGE, MIXING, SURFACE PREPARATION, DRK.	
		ITH OWNER PRIOR TO BEGINNING WORK.	
		OT STORE FLAMMABLE MATERIALS ON THE OM THE SITE AND SECURELY STORE THEM AT	
E MATERIALS TRACKE NAL COST TO THE OW	D TO AREAS O NER. CONDUC RE THE ENTIRI	R LOOSE MATERIALS TO AREAS OUTSIDE OF UTSIDE OF THE CONSTRUCTION ZONE AS T AN INSPECTION OF THE PROJECT AREA AT E WORK AREA IS CLEAN. THIS REQUIREMENT CH OR ON BREAKS.	SME Project No.
DEBRIS RESULTING F	ROM THE REP	AIR WORK FROM THE SITE AND DISPOSE OF	091744.00
		ID THE GROUNDS, INCLUDING SPILLED OR S, AND HYDRAULIC LEAKAGE FROM THE	Project Manager: KD
D GREENBELT AREAS EBRIS OFF SITE AT AN		., HYDROSEED, AND HIGH VELOCITY MULCH ISPOSAL LOCATION.	Designer: KD
K, CLEAR THE ENTIRE		PMENT, UNUSED MATERIALS, AND RUBBISH.	CADD:
			TM Checked By:
			AC
			Reviewed By: JT
			Sheet No.
			CS1
			NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME © 2023

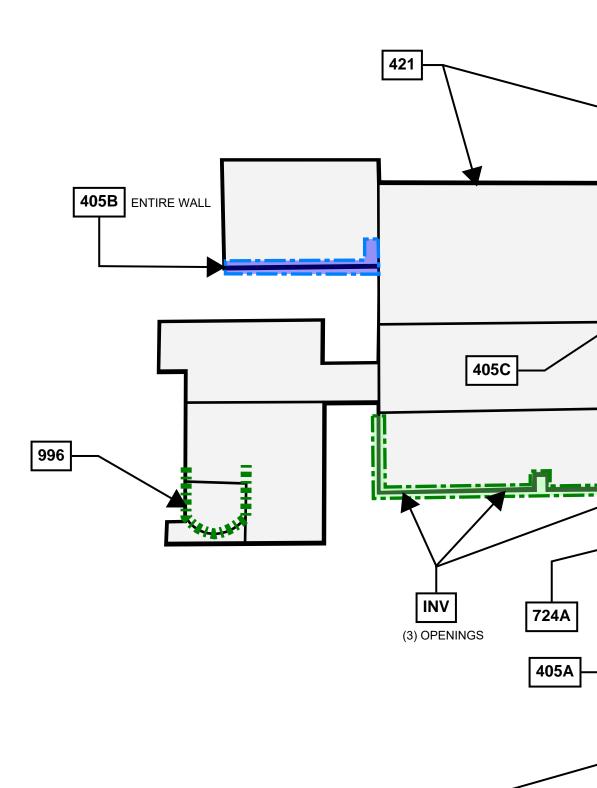


742 -

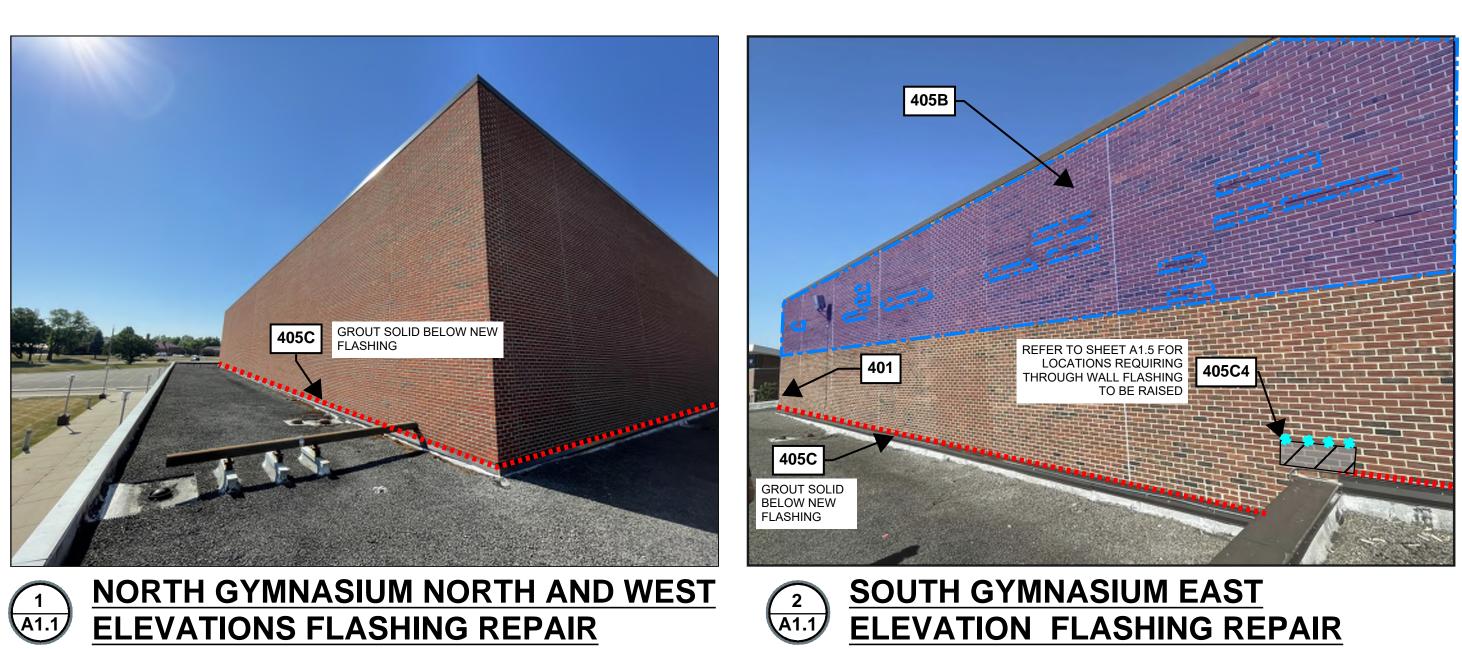

 


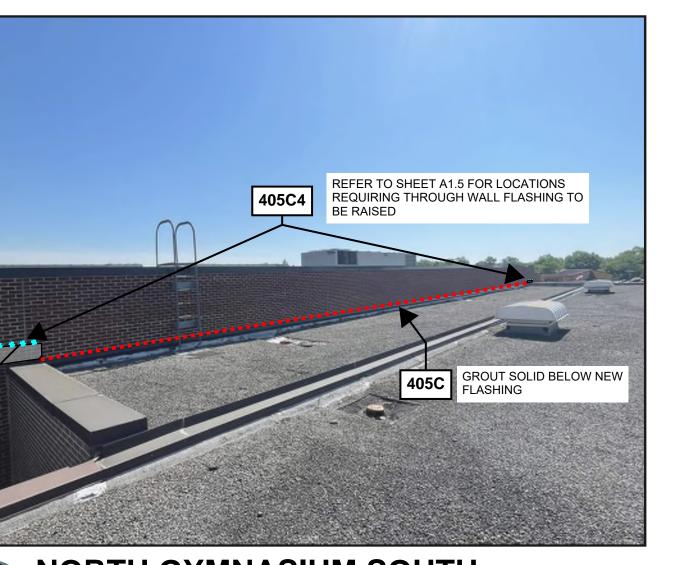

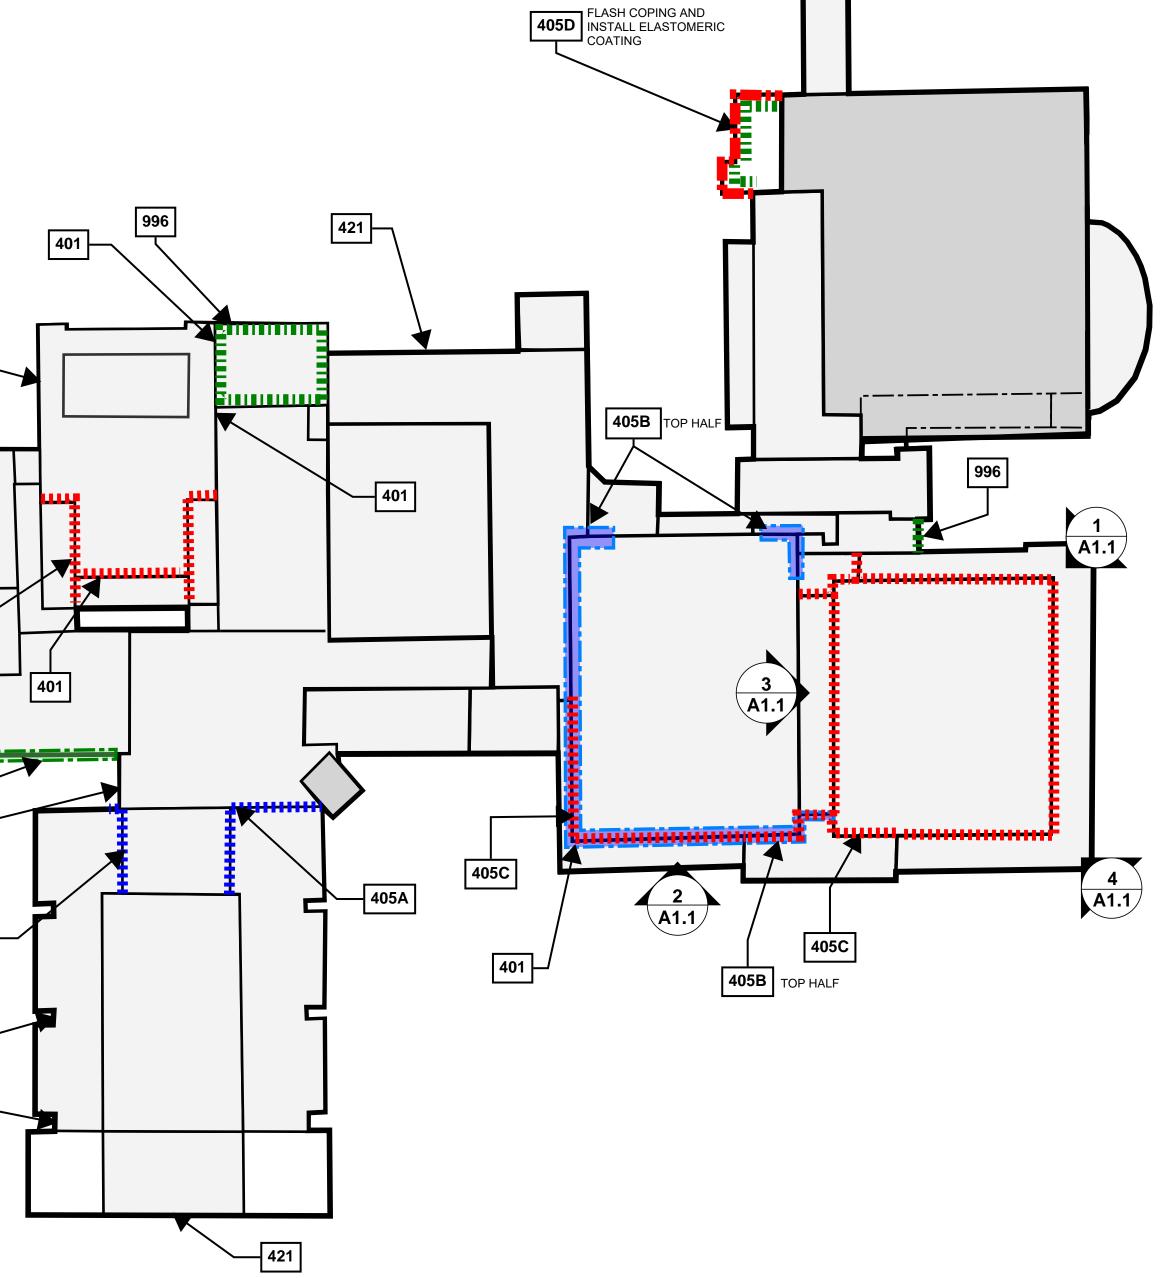

	ENCLOSURE REPAIR KEYNOTES				
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL	
401		MASONRY CRACK REPAIR	M16/A1.2	401/A5.1	
405A		REMOVE DETERIORATED MORTAR AND REPOINT	M12/A1.2	405A/A5.1	
405B		GRIND EXPOSED HORIZONTAL REINFORCING CLEAN AND REPOINT	M7/A1.2 M8/A1.2	405B/A5.1	
405C		REMOVE AND REPLACE EXISTING COPPER THROUGH WALL FLASHING*	M1-M6/A1.2	405C/A5.1	
405D		COPING FLASHING REPAIR	M14/A1.2 M15/A1.2	405D/A5.1	
421		REPLACE MISSING BRICK(S) AT NOTED LOCATIONS	M12/A1.2	421/A5.1	
724A		PATCH DETERIORATED CANOPY AND RECOAT TO MATCH EXISTING	M10/A1.2	724A/A5.2	
742		ROUT AND SEAL CRACKS AT FIBERBOARD PANELS ABOVE ENTRANCES	M11/A1.2	742/A5.1	
996		INSTALL ELASTOMERIC COATING**	M9/A1.2 M15/A1.2		
INV		MASONRY INVESTIGATION: PROVIDE EXPLORATORY OPENINGS FOR ENGINEER'S REVIEW	M17 - M19/A1.2		

*REFER TO SHEET A1.5 FOR LOCATIONS REQUIRING THROUGH WALL FLASHING TO BE RAISED **REFER TO SPECIFICATION SECTION 099653 FOR ELASTOMERIC COATING INSTALLATION

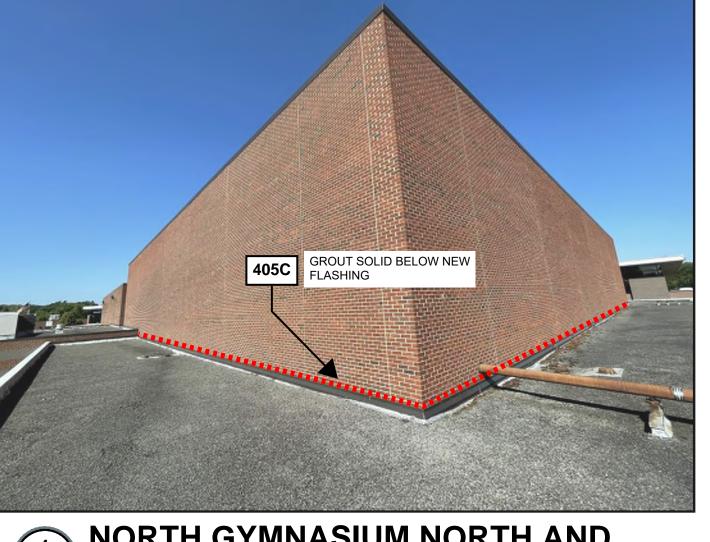

(4) <u>NORTH GYMNASIUM NORTH AND</u> EAST ELEVATIONS FLASHING REPAIR

SAME www.sme-usa.com					
DRAWING NOTE: SCALE DEP 24" X 36" AND WILL SCAL PRINTED ON ANY OTH	E INCORRECTLY IF				
Project WATERFORD S DISTRICT BUILDING ENC REPAIRS - 4 BU	LOSURE				
Project Location WATERFORD T	̈ΨΡ, ΜΙ				
Sheet Name MOTT HIGH SC ENCLOSURE R PLAN					
Engineer's Seal					
Revisions					
REV ISSUED FOR OWNER REVIEW	DATE BY 12/22/23 AKC				
BID	1/16/24 KMD				
SME Project No. 091744	.00				
Project Manager: KD					
Designer:					
CADD:					
Checked By:					
Reviewed By: JT					
Sheet No.					
A1	.1				








ITEM 405C - FLASHING REPAIRS -PERFORMING ARTS CENTER

 M2






M5



(M10) ITEM 724A - CANOPY PATCH REPAIRS

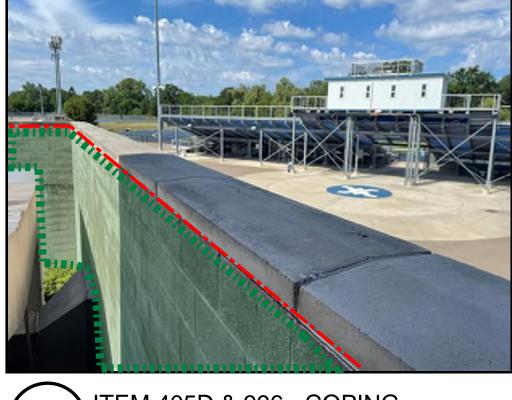






ELEVATION



M11 <u>ITEM 742 - CANOPY REPAIRS -</u> <u>ROUTE AND SEAL CRACKED</u> <u>FIBERBOARD</u>

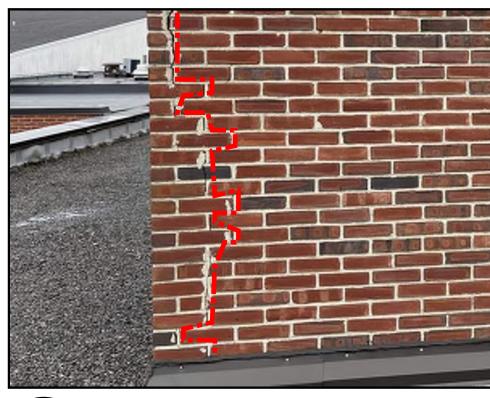

(M16

ITEM 401 - MASONRY CRACK REPAIR





(M3) <u>ITEM 405C - FLASHING REPAIRS -</u> SOUTH GYMNASIUM EAST ELEVATION



 



M7 ITEM 405B - HORIZONTAL JOINT REINFORCEMENT REPAIRS




M12 ITEM 421 - BRICK REPLACEMENT





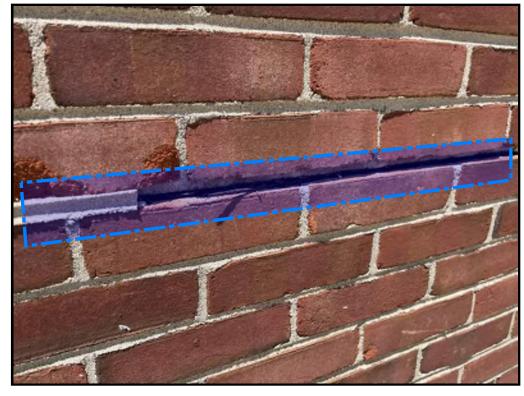

M8 ITEM 405B - HORIZONTAL JOINT REINFORCEMENT REPAIRS

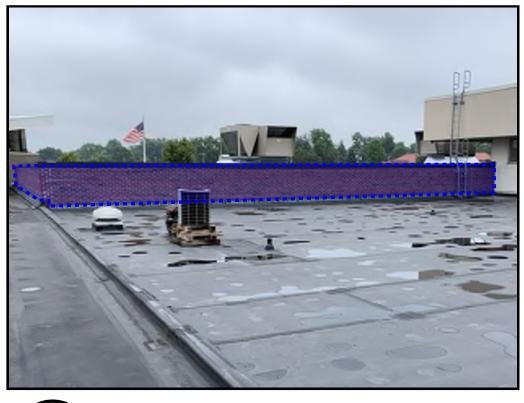


M13) <u>ITE</u> <u>PAI</u>

ITEM 405A - BRICK REPOINTING AT PARAPET



M18 ITEM INV - PROPOSED EXPLORATORY OPENING LOCATION NO. 2



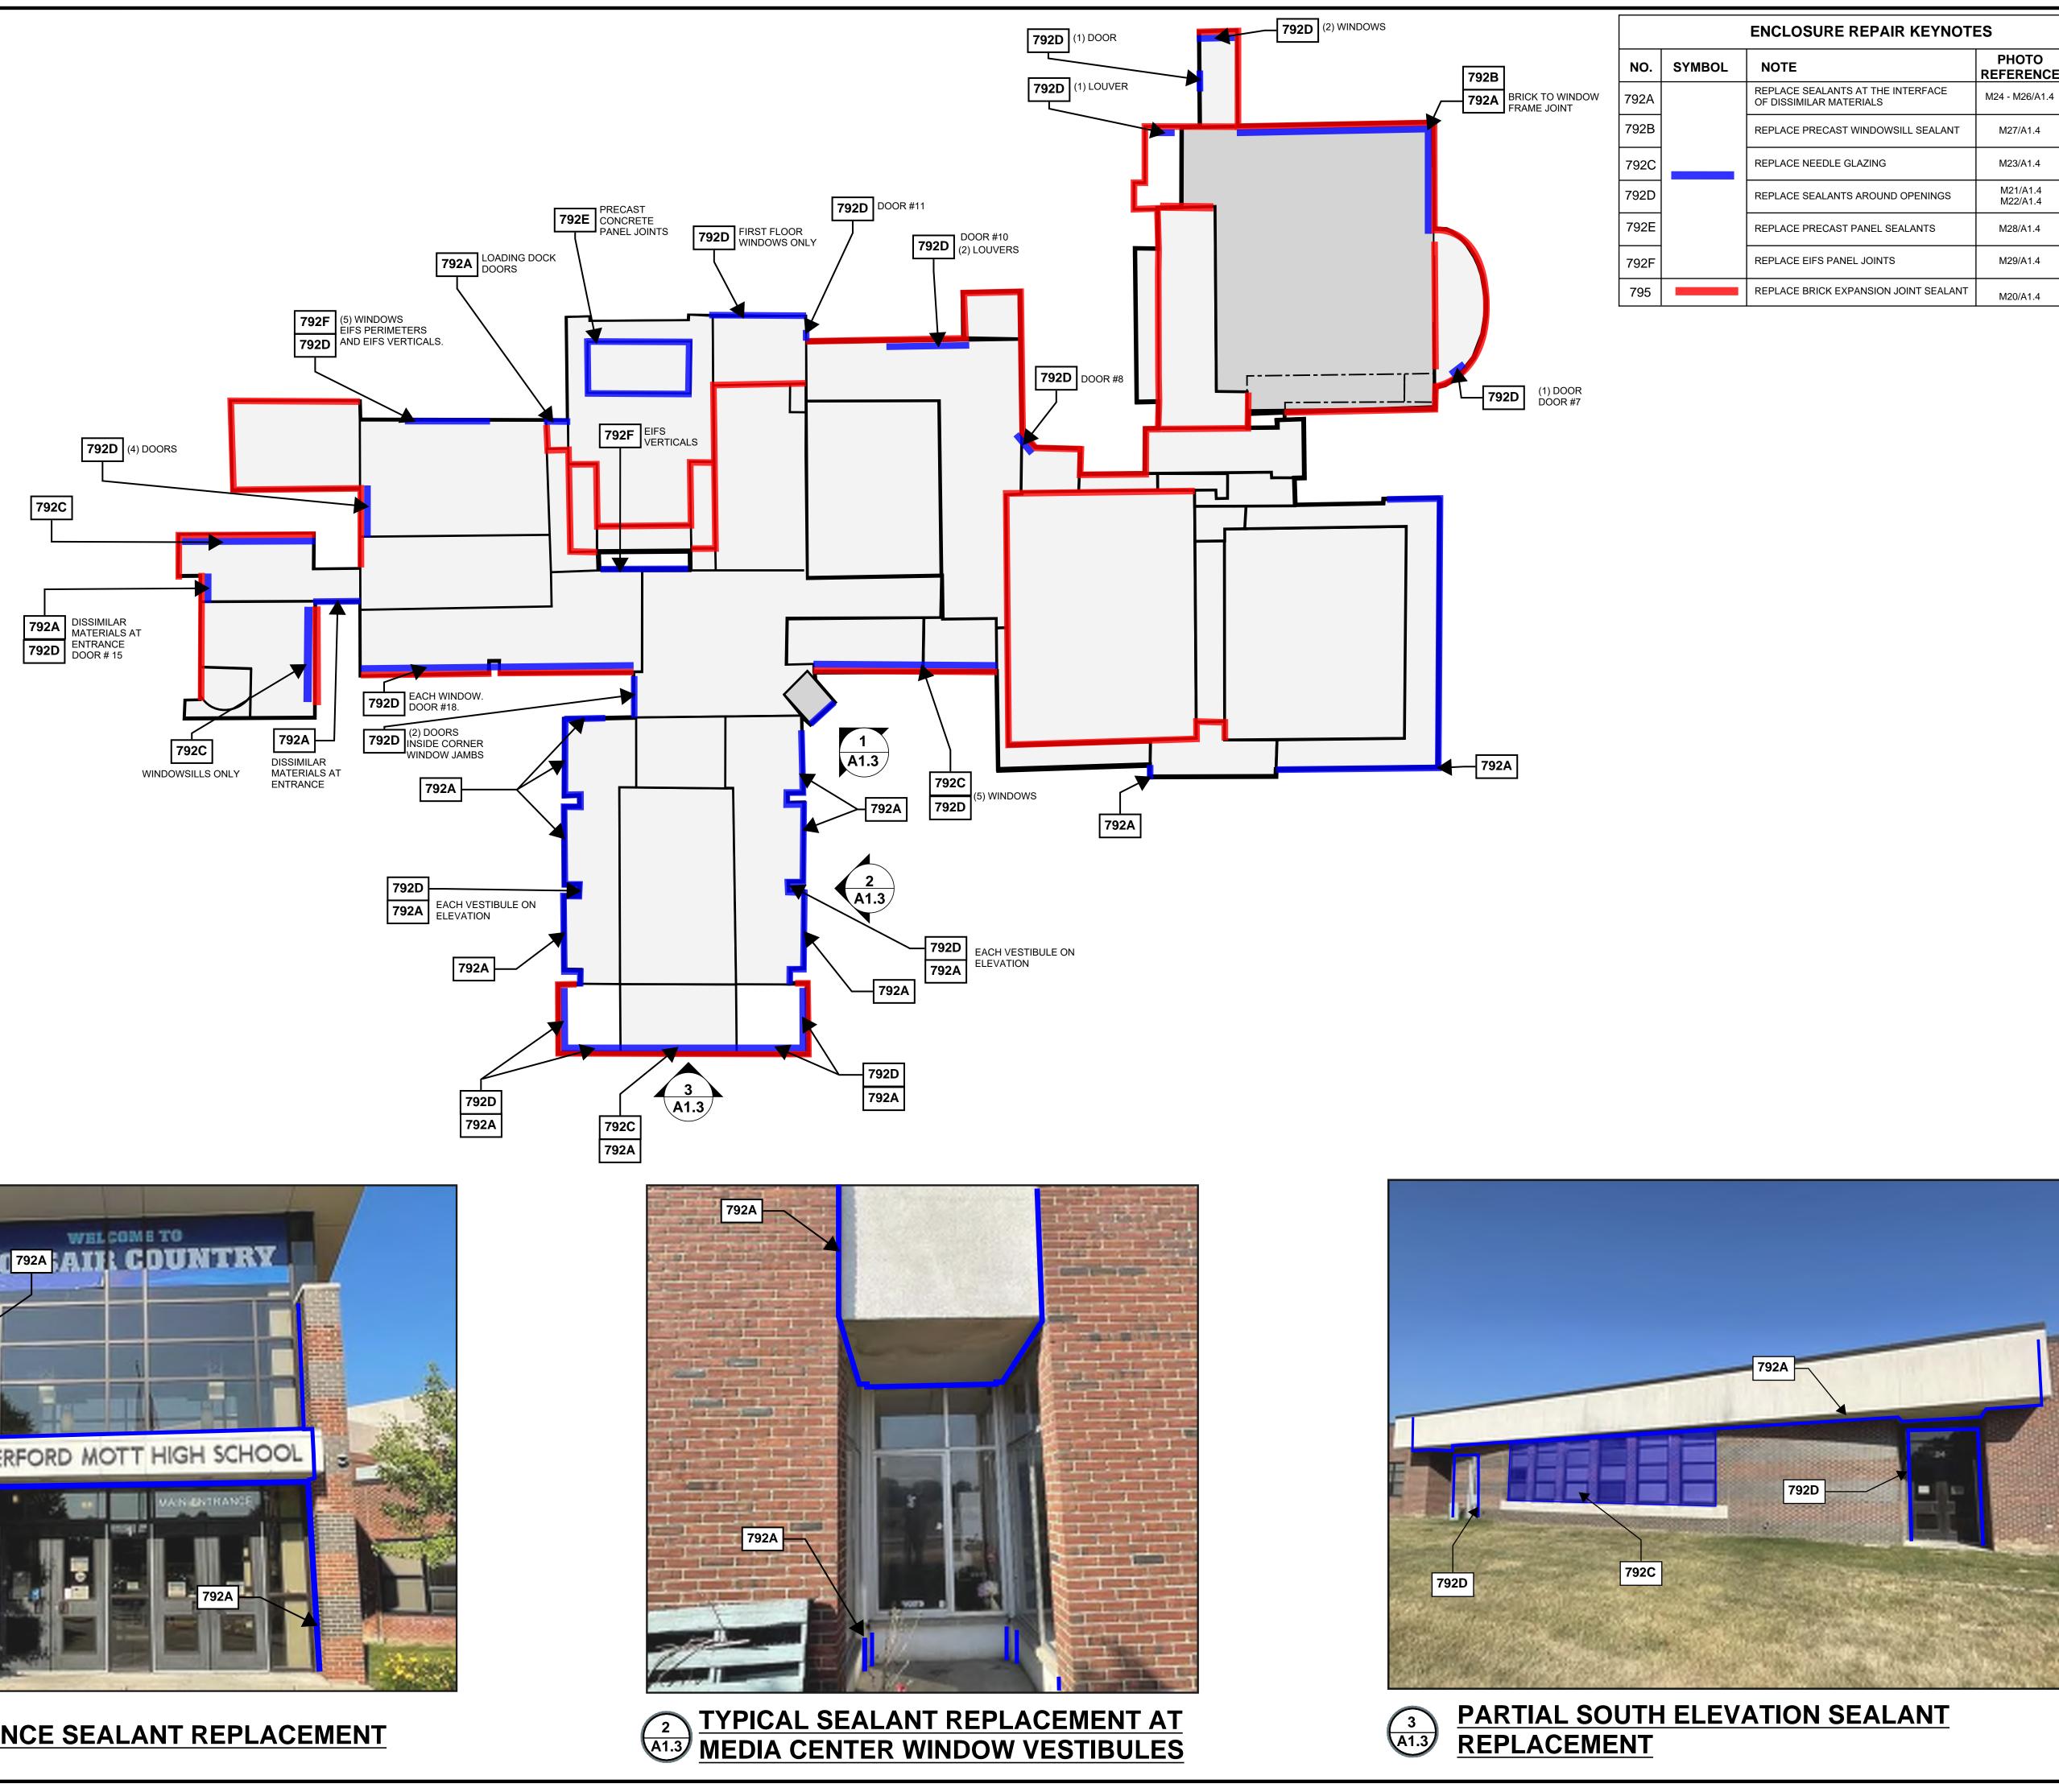





MAIN ENTRANCE SEALANT REPLACEMENT

	ENCLOSURE REPAIR KEYNOTES				
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL	
792A		REPLACE SEALANTS AT THE INTERFACE OF DISSIMILAR MATERIALS	M24 - M26/A1.4	792A/A5.2	
792B		REPLACE PRECAST WINDOWSILL SEALANT	M27/A1.4	792B/A5.2	
792C		REPLACE NEEDLE GLAZING	M23/A1.4	792C/A5.2	
792D		REPLACE SEALANTS AROUND OPENINGS	M21/A1.4 M22/A1.4	792D/A5.2	
792E		REPLACE PRECAST PANEL SEALANTS	M28/A1.4	792E/A5.2	
792F		REPLACE EIFS PANEL JOINTS	M29/A1.4	792F/A5.2	
795		REPLACE BRICK EXPANSION JOINT SEALANT	M20/A1.4	795/A5.2	



Project WATERFORD SCHOOL DISTRICT **BUILDING ENCLOSURE REPAIRS - 4 BUILDINGS**

Project Location

WATERFORD TWP, MI

Sheet Name

MOTT HIGH SCHOOL SEALANT REPAIR PLAN

Engineer's Seal

Dovid			
Revis	sions		
REV	SIONS ISSUED FOR	DATE	BY
		DATE 12/22/23	BY AKC
	ISSUED FOR		
	ISSUED FOR OWNER REVIEW	12/22/23	AKC
	ISSUED FOR OWNER REVIEW	12/22/23	AKC
	ISSUED FOR OWNER REVIEW	12/22/23	AKC
	ISSUED FOR OWNER REVIEW	12/22/23	AKC

SME Project No.	
	091744.00
Project Manager:	
	KD
Designer:	

KD CADD: ТМ Checked By:


AC **Reviewed By:**

Sheet No.




NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME © 2022

JT

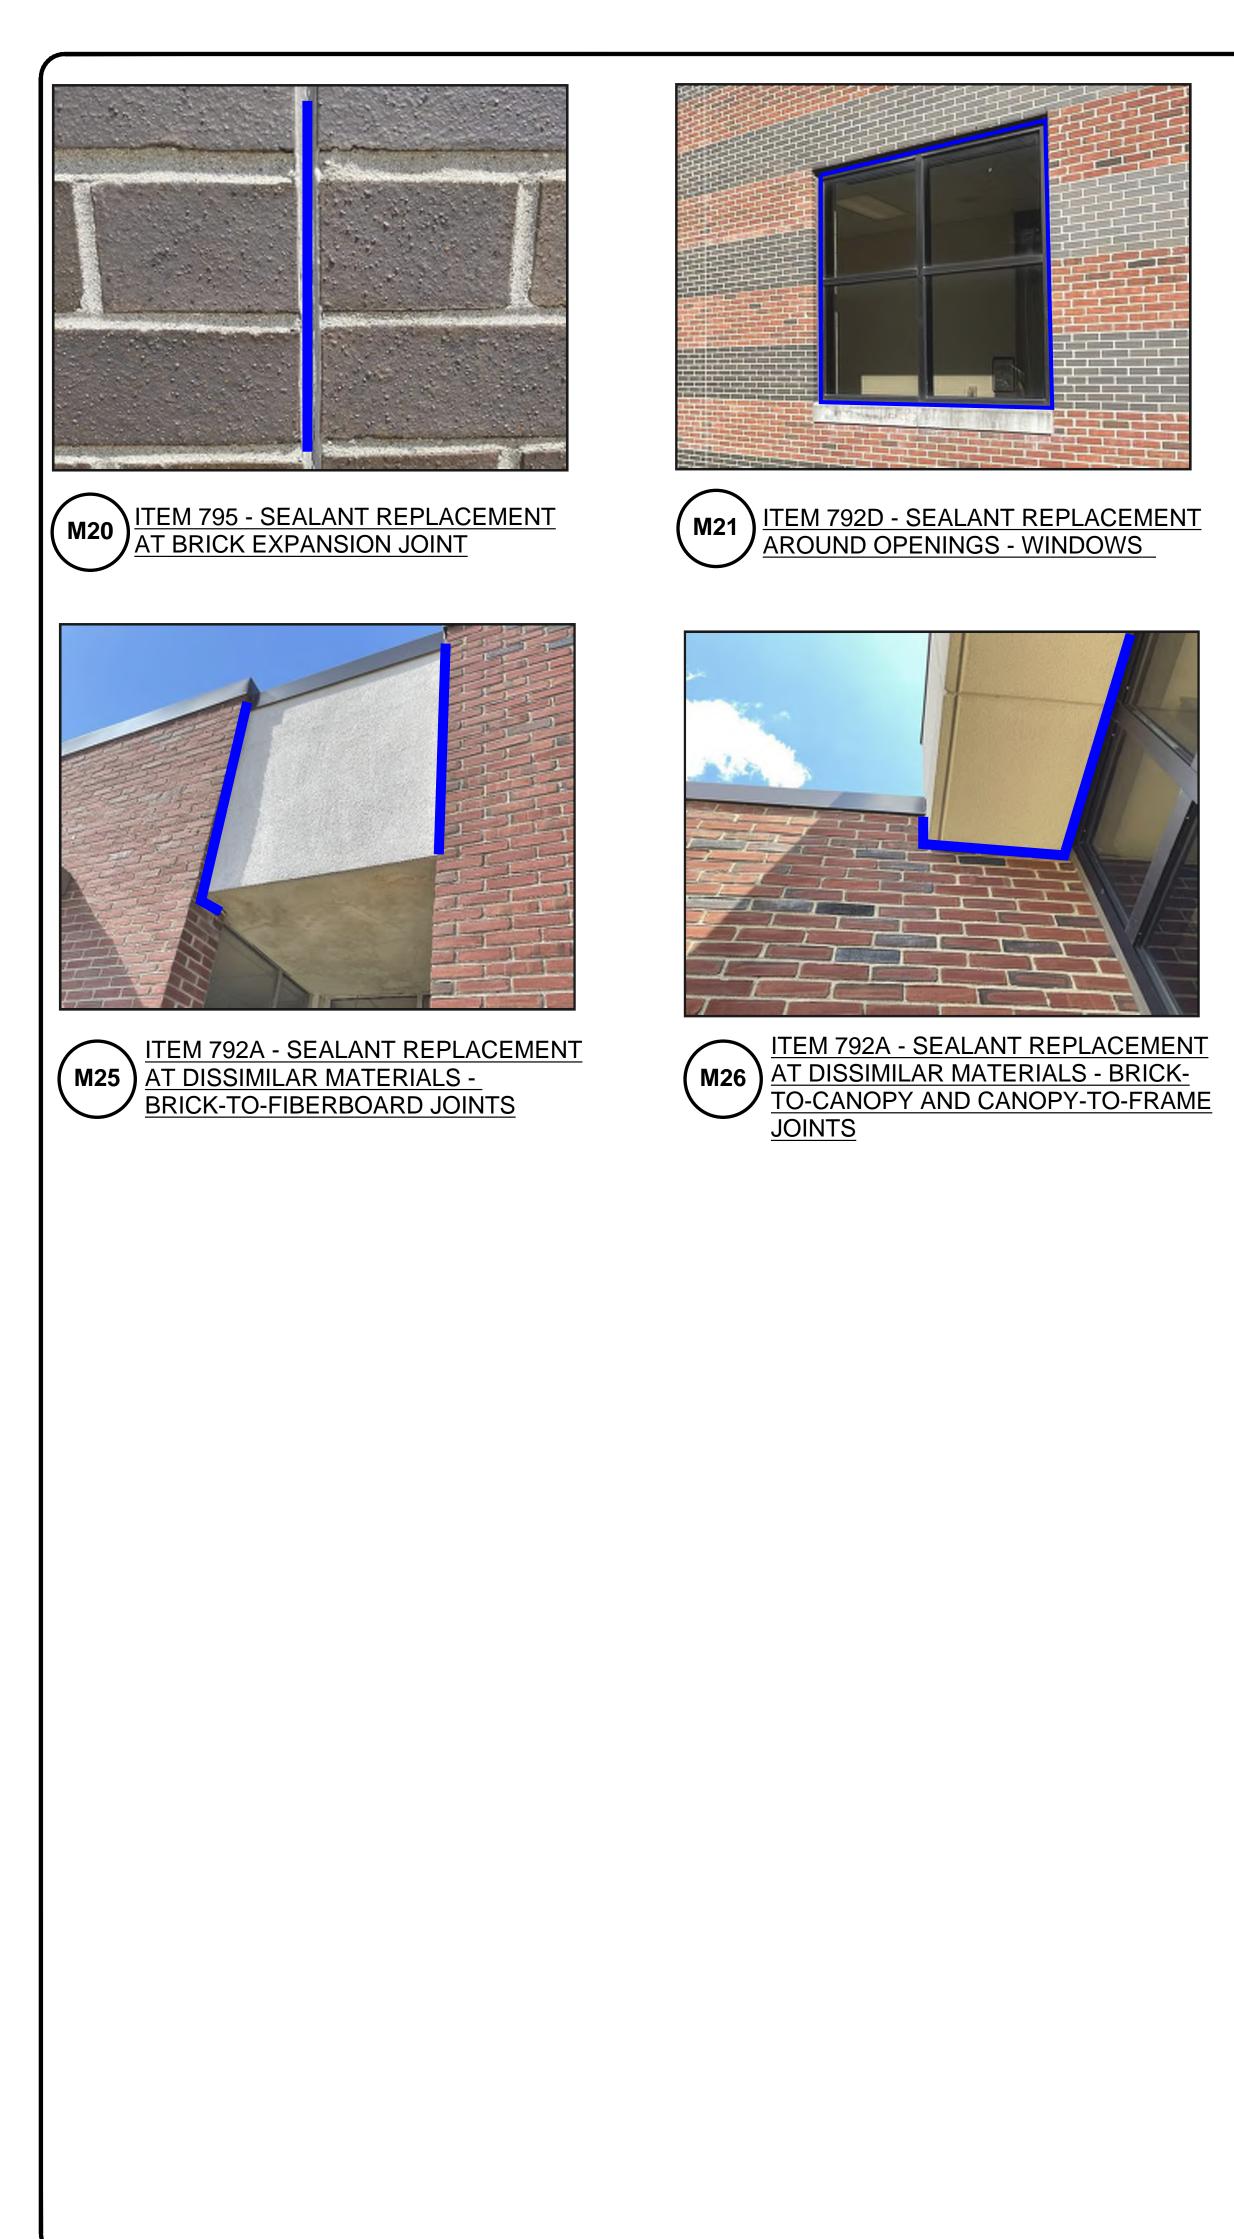




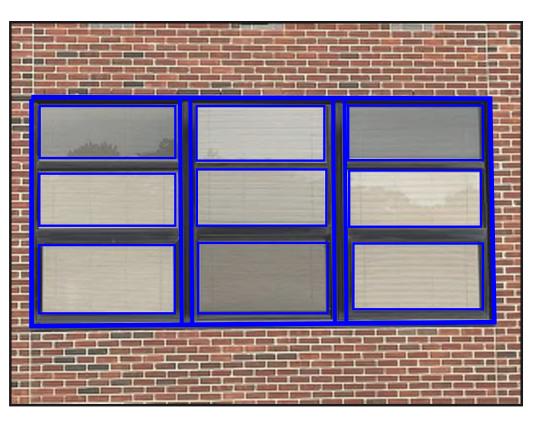





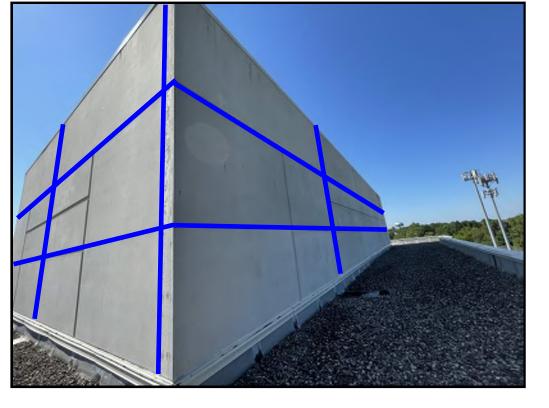



(м22)




M24 <u>ITEM 792A - SEALANT REPLACEMENT</u> <u>AT DISSIMILAR MATERIALS -</u> <u>FIBERBOARD-TO-FRAME JOINTS</u>








\bigcirc SI						
www.sme-usa.com						
DRAWING NOTE: SCALE DEPICTED IS MEANT FOR 24" X 36" AND WILL SCALE INCORRECTLY IF PRINTED ON ANY OTHER SIZE MEDIA						
DISTRICT BUILDING ENCLO	WATERFORD SCHOOL					
Project Location WATERFORD TW	/P, MI					
Sheet Name MOTT HIGH SCH SEALANT REPAI CONDITIONS						
Engineer's Seal						
Revisions						
REV ISSUED FOR OWNER REVIEW	DATE 12/22/23	BY AKC				
REV ISSUED FOR						
REV ISSUED FOR OWNER REVIEW	12/22/23	AKC				
REV ISSUED FOR OWNER REVIEW	12/22/23	AKC				
REV ISSUED FOR OWNER REVIEW	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID Image: SME Project No.	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID Image: Comparison of the second	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID Image: Comparison of the second	12/22/23 1/16/24	AKC				
ISSUED FOR OWNER REVIEW BID BID SME Project No. O91744.0 Project Manager: KD Designer: KD	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID SME Project No. O91744.0 Project Manager: KD Designer: KD CADD: TIM	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID SME Project No. O91744.0 Project Manager: KD Designer: KD CADD: TM Checked By: AC	12/22/23 1/16/24	AKC				
REV ISSUED FOR OWNER REVIEW BID BID SME Project No. O91744.0 Project Manager: KD Designer: KD CADD: TM Checked By: AC Reviewed By: JT	12/22/23 1/16/24	AKC				



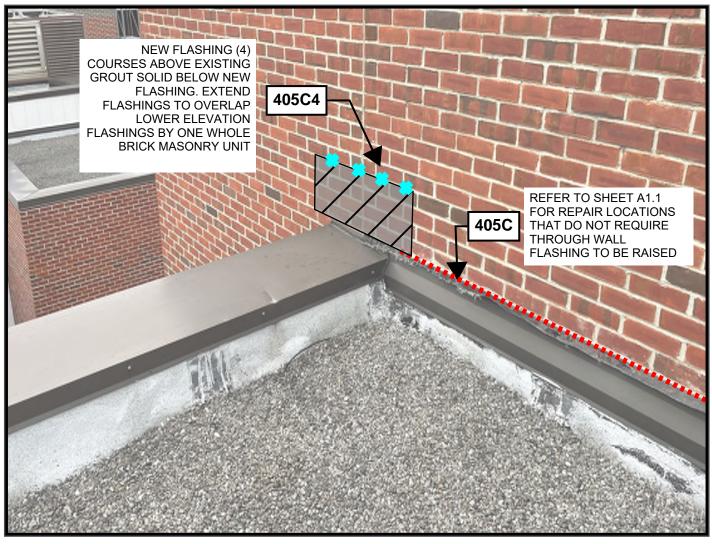

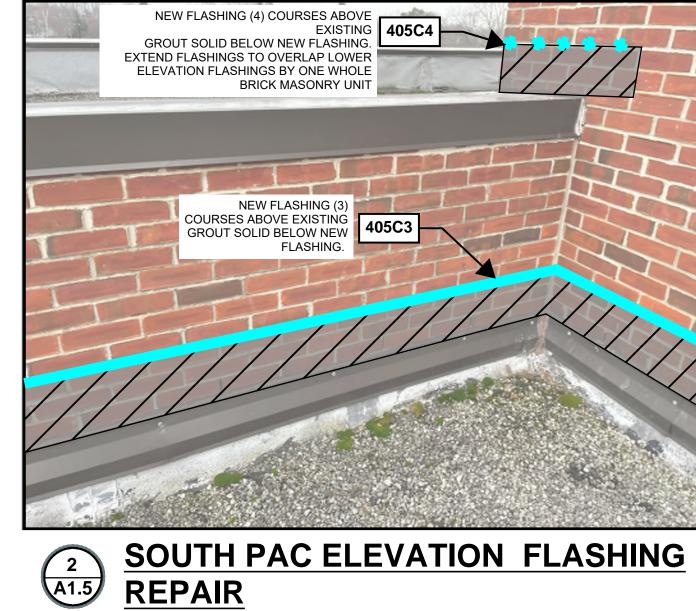


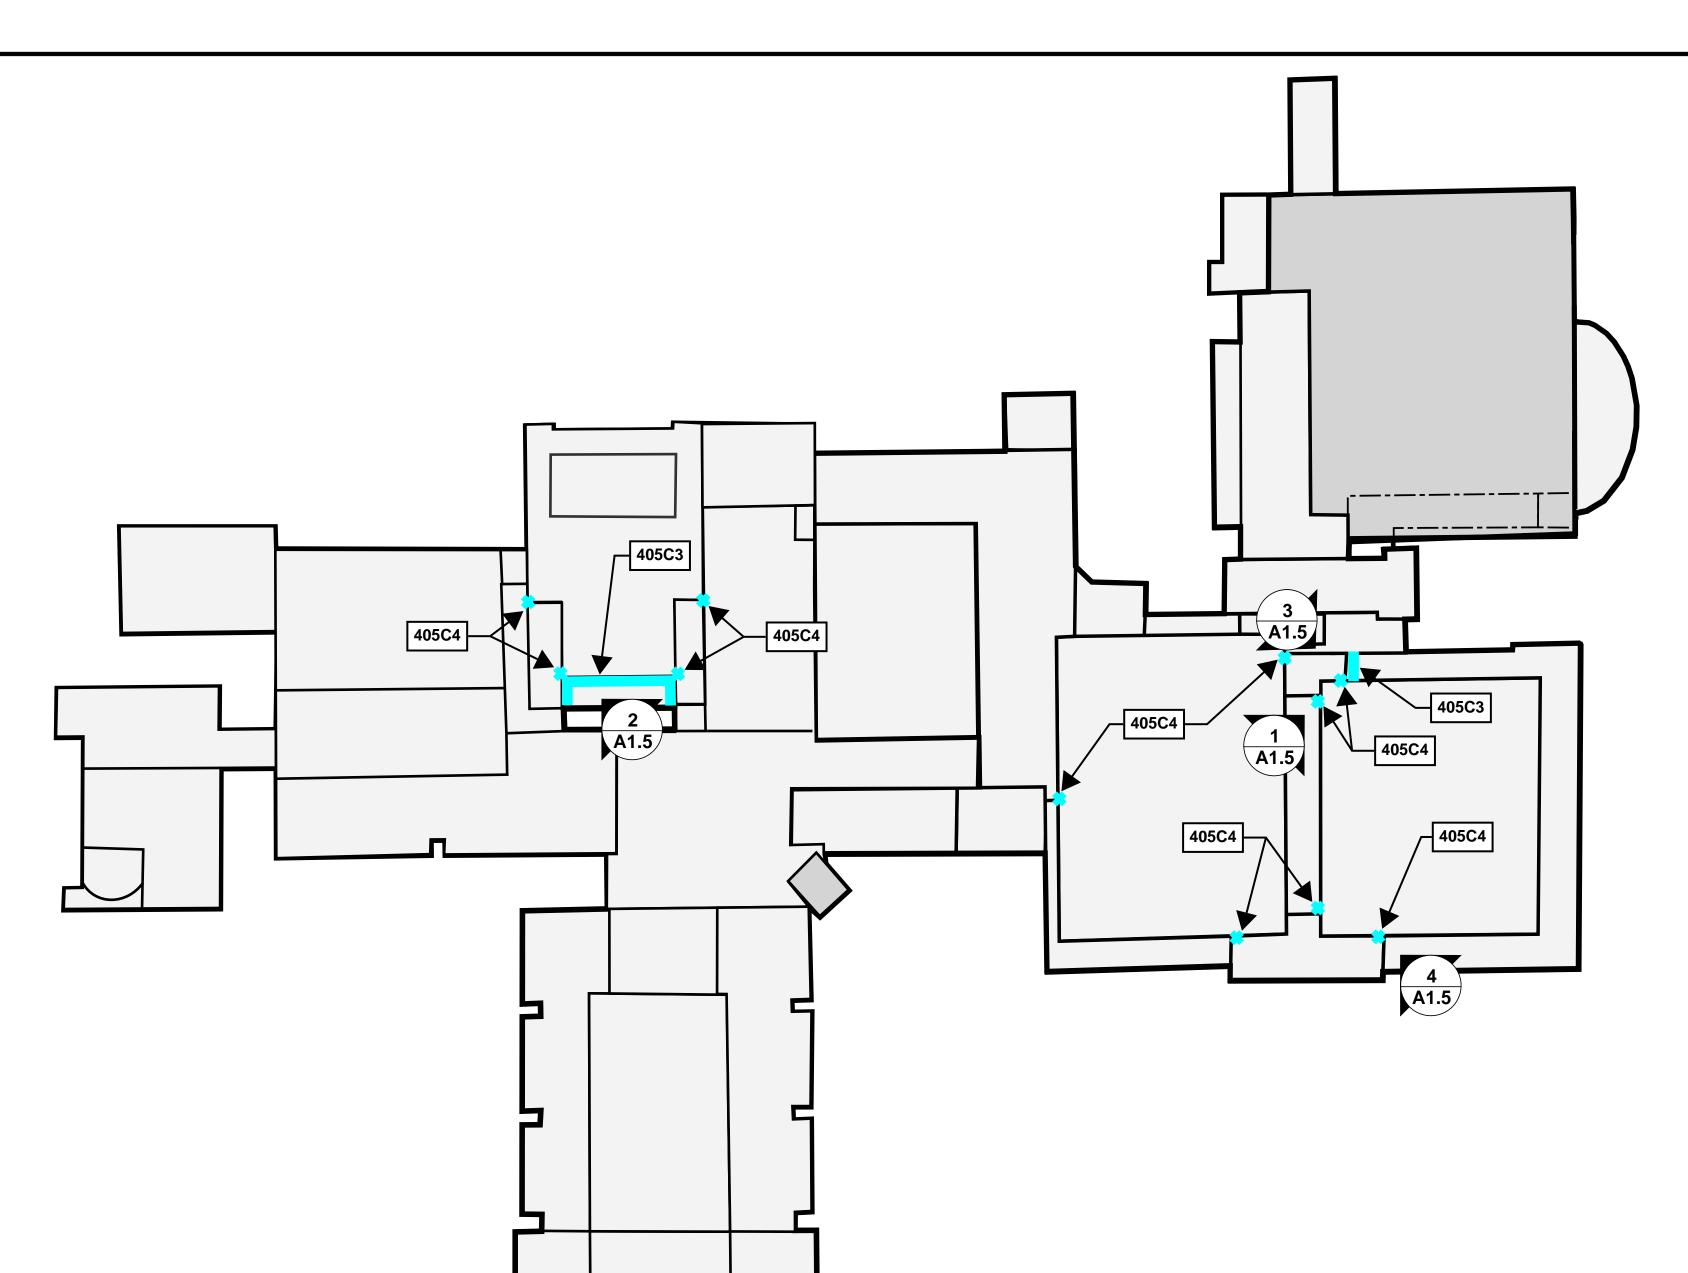

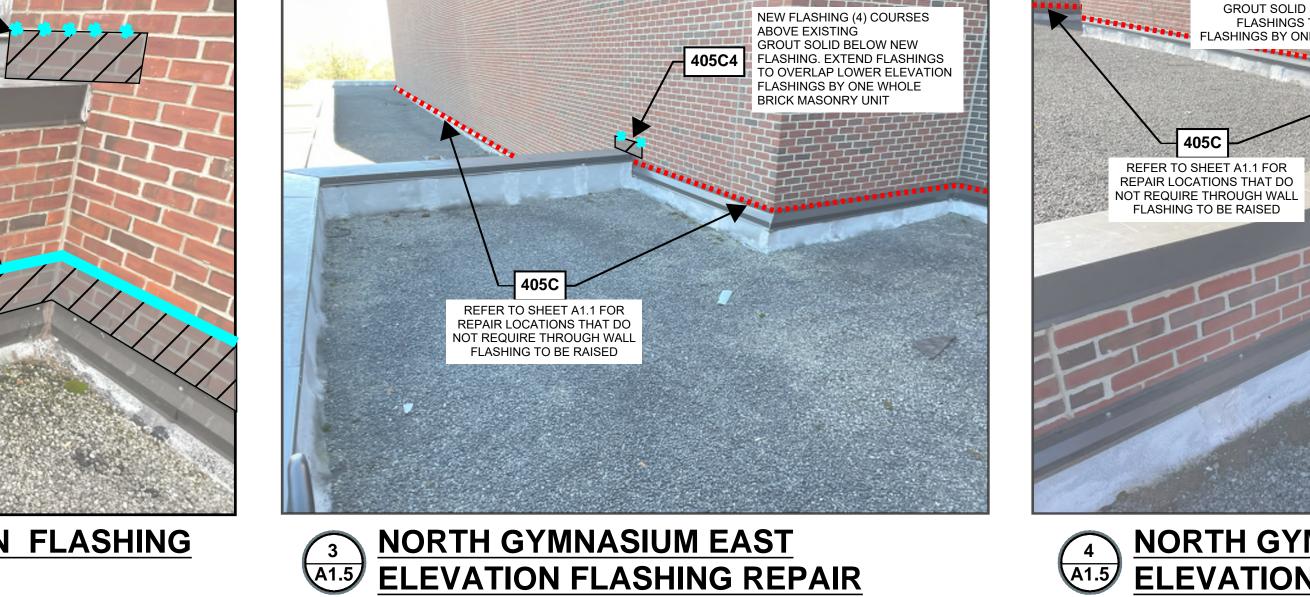

THRC	THROUGH WALL FLASH HEIGHT KEYNOTES				
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL	
405C4	*	DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 4 COURSES ABOVE EXISTING EXISTING THROUGH WALL FLASHING HEIGHT		405C/A5.1	
405C3		DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 3 COURSES ABOVE EXISTING THORUGH WALL FLASHING/COUNTERFLASHING HEIGHT		405C/A5.1	
REFER T	O SHEET A1.1 FC	R FLASHING REPAIR LOCATIONS THAT DO NOT F	REQUIRE THROUG	H WALL	

FLASHINGS TO BE RAISED.

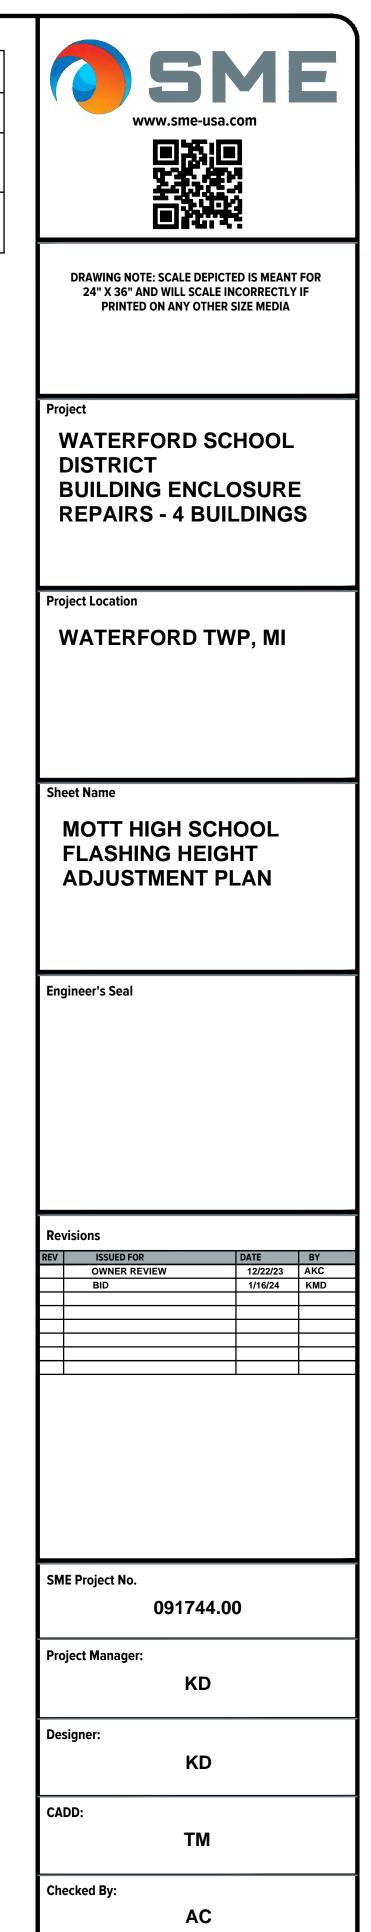

(4) <u>NORTH GYMNASIUM SOUTH</u> ELEVATION FLASHING REPAIR

NEW FLASHING (4) COURSES ABOVE EXISTING GROUT SOLID BELOW NEW FLASHING. EXTEND FLASHINGS TO OVERLAP LOWER ELEVATION

LASHINGS BY ONE WHOLE BRICK MASONRY UNIT


405C





Reviewed By:




NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME © 2022

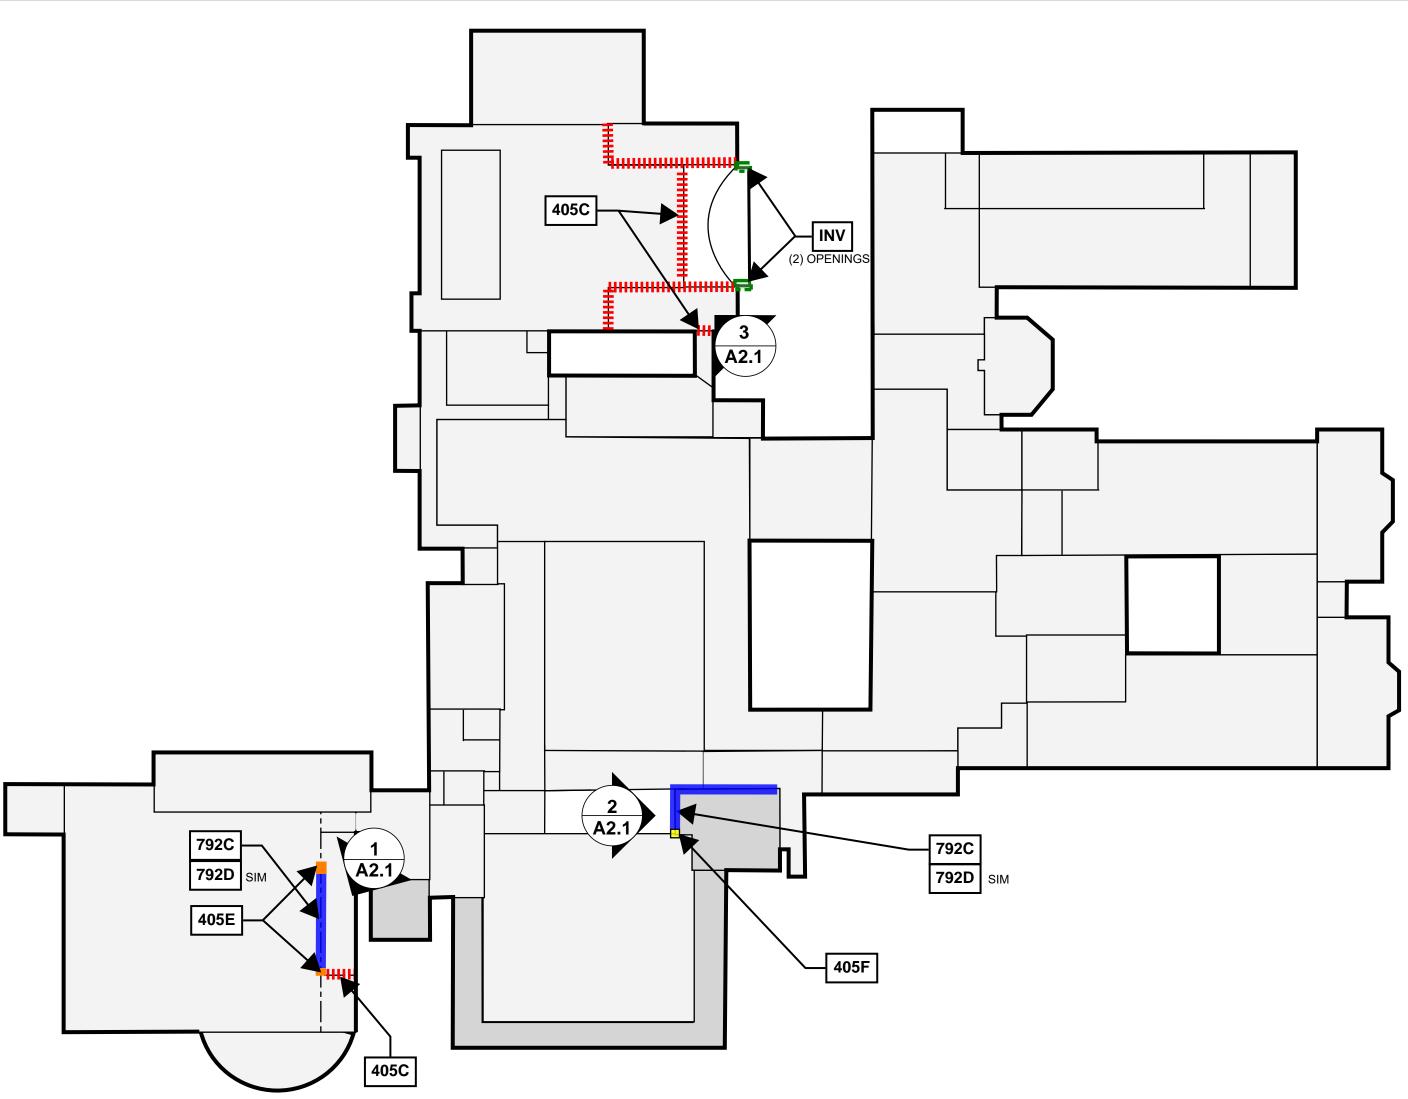

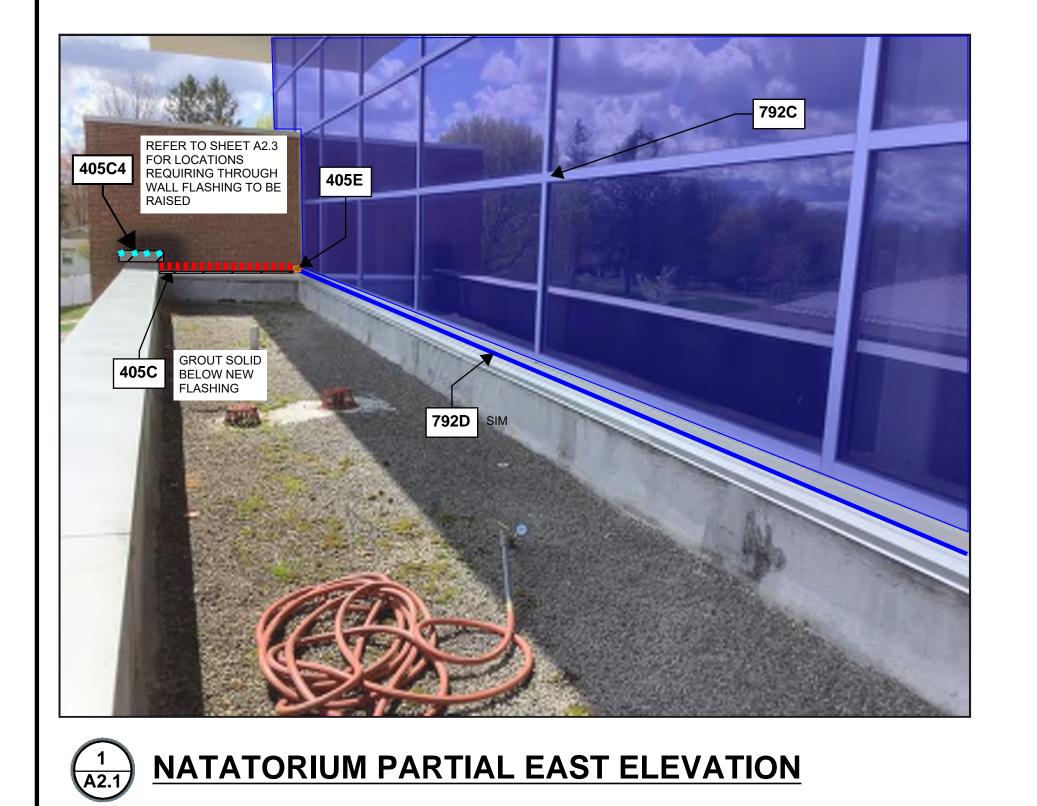


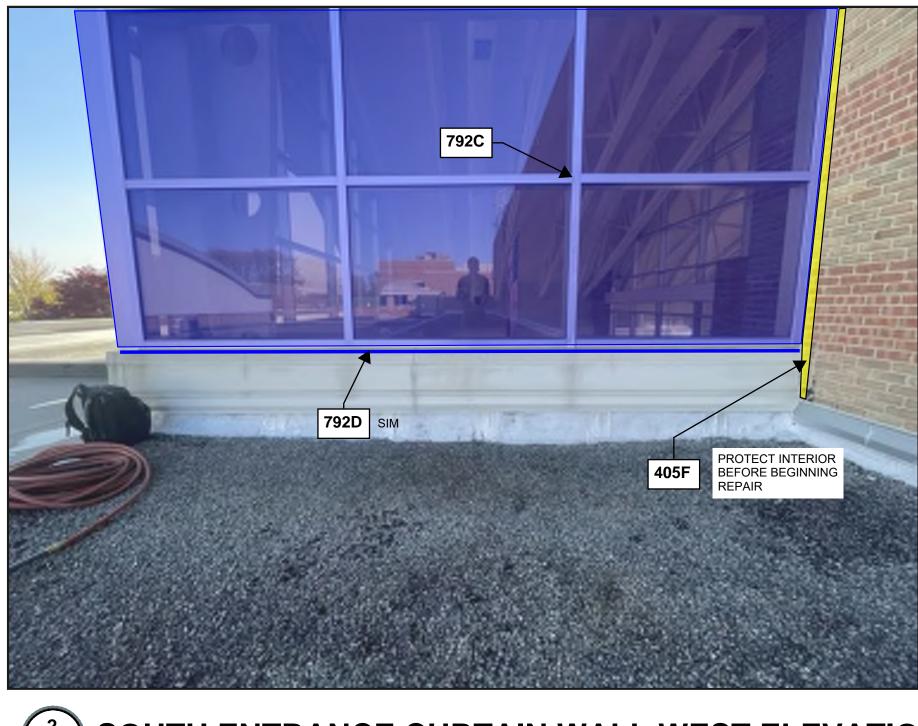



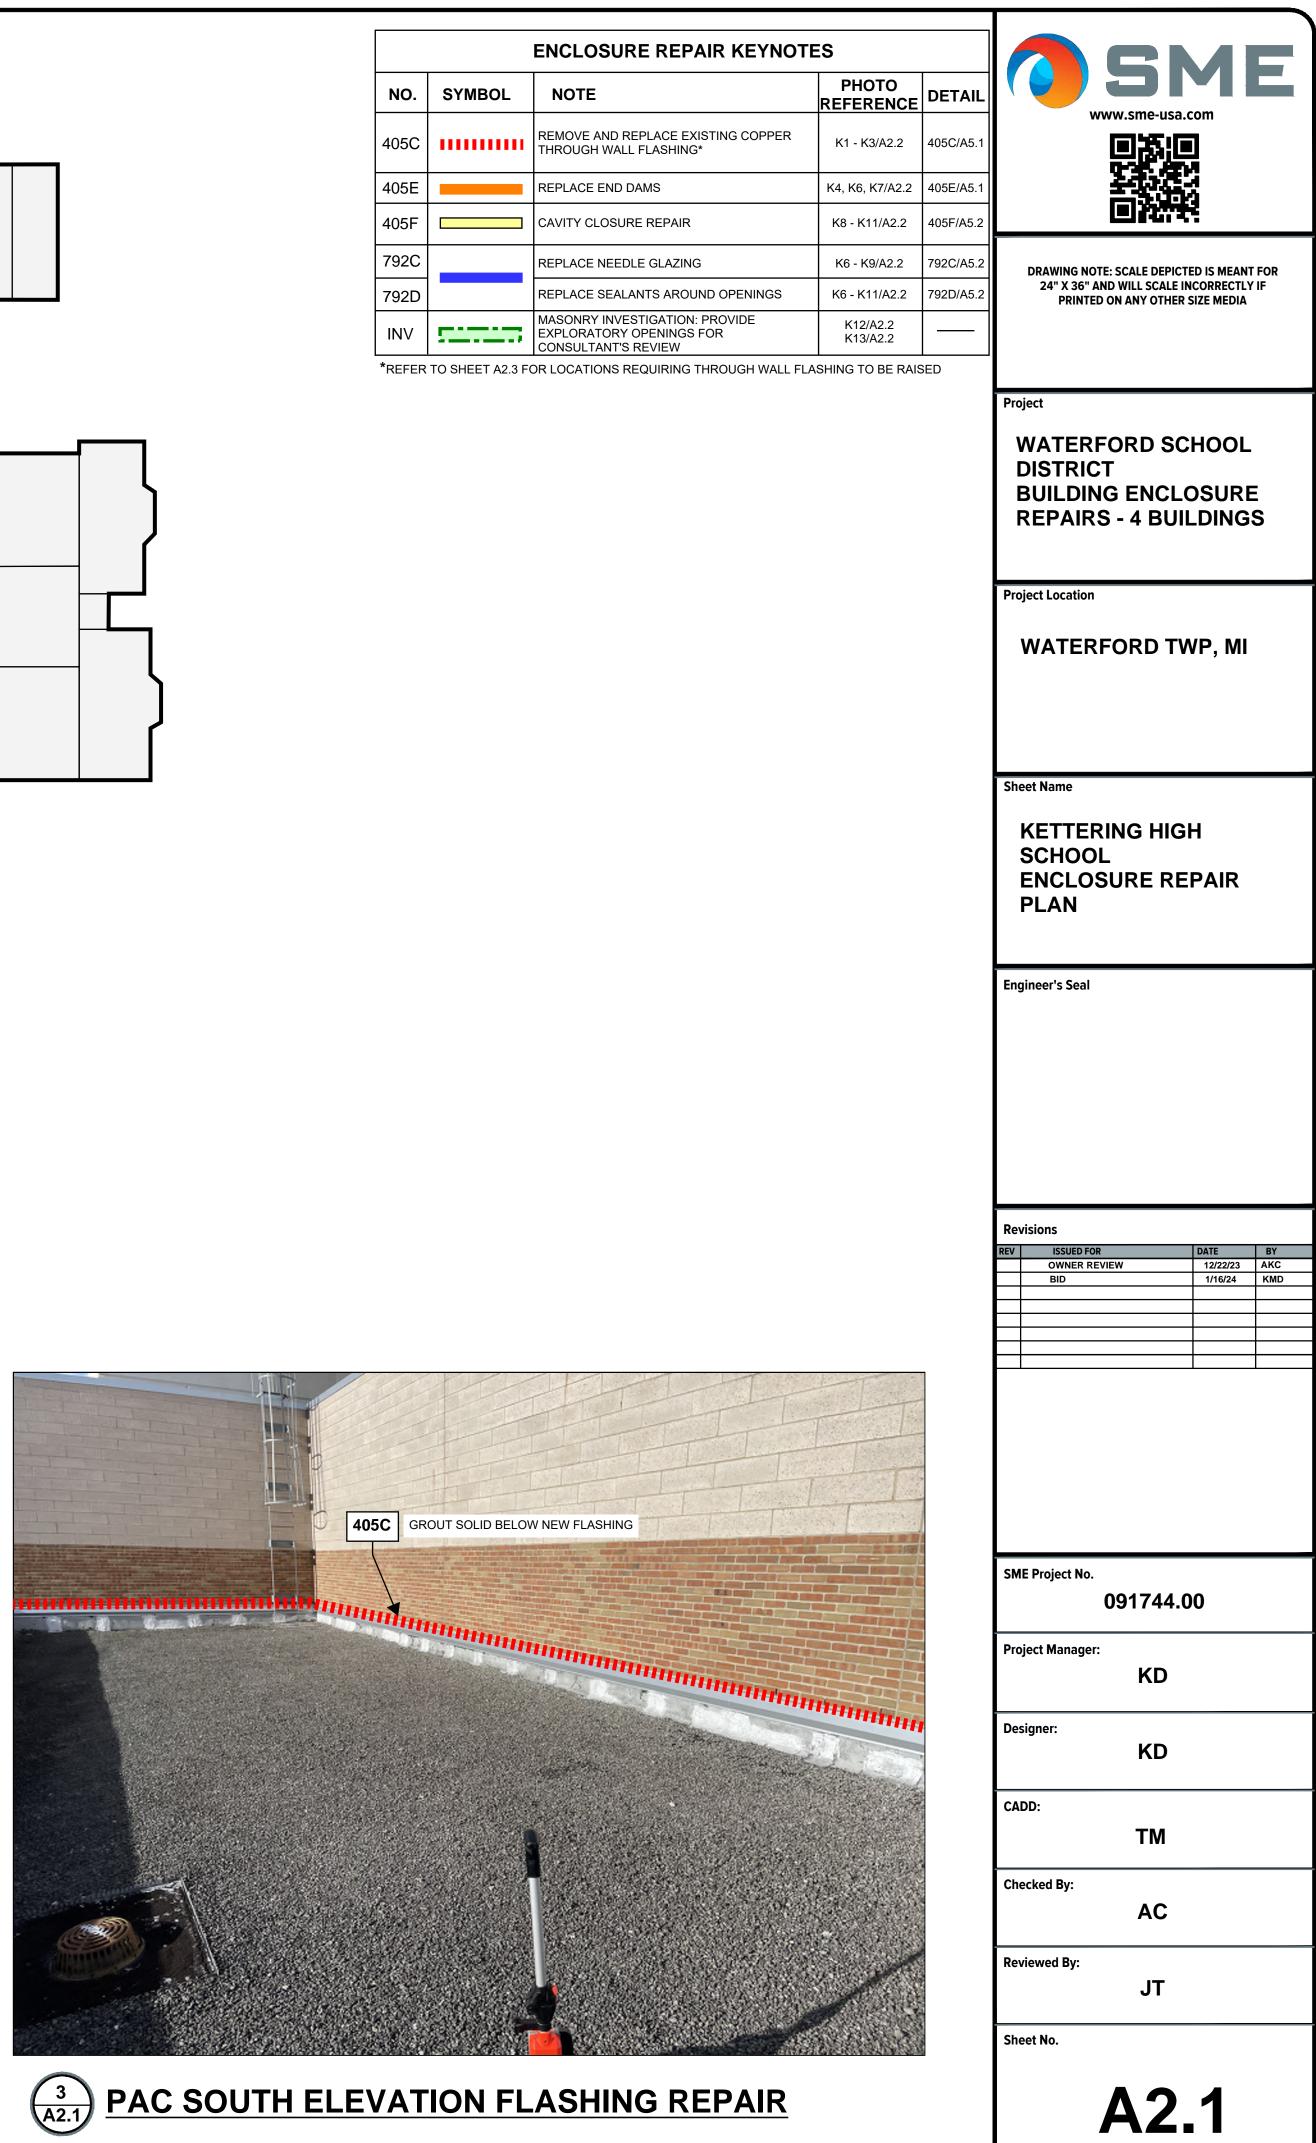

2 A2.1 SOUTH ENTRANCE CURTAIN WALL WEST ELEVATION

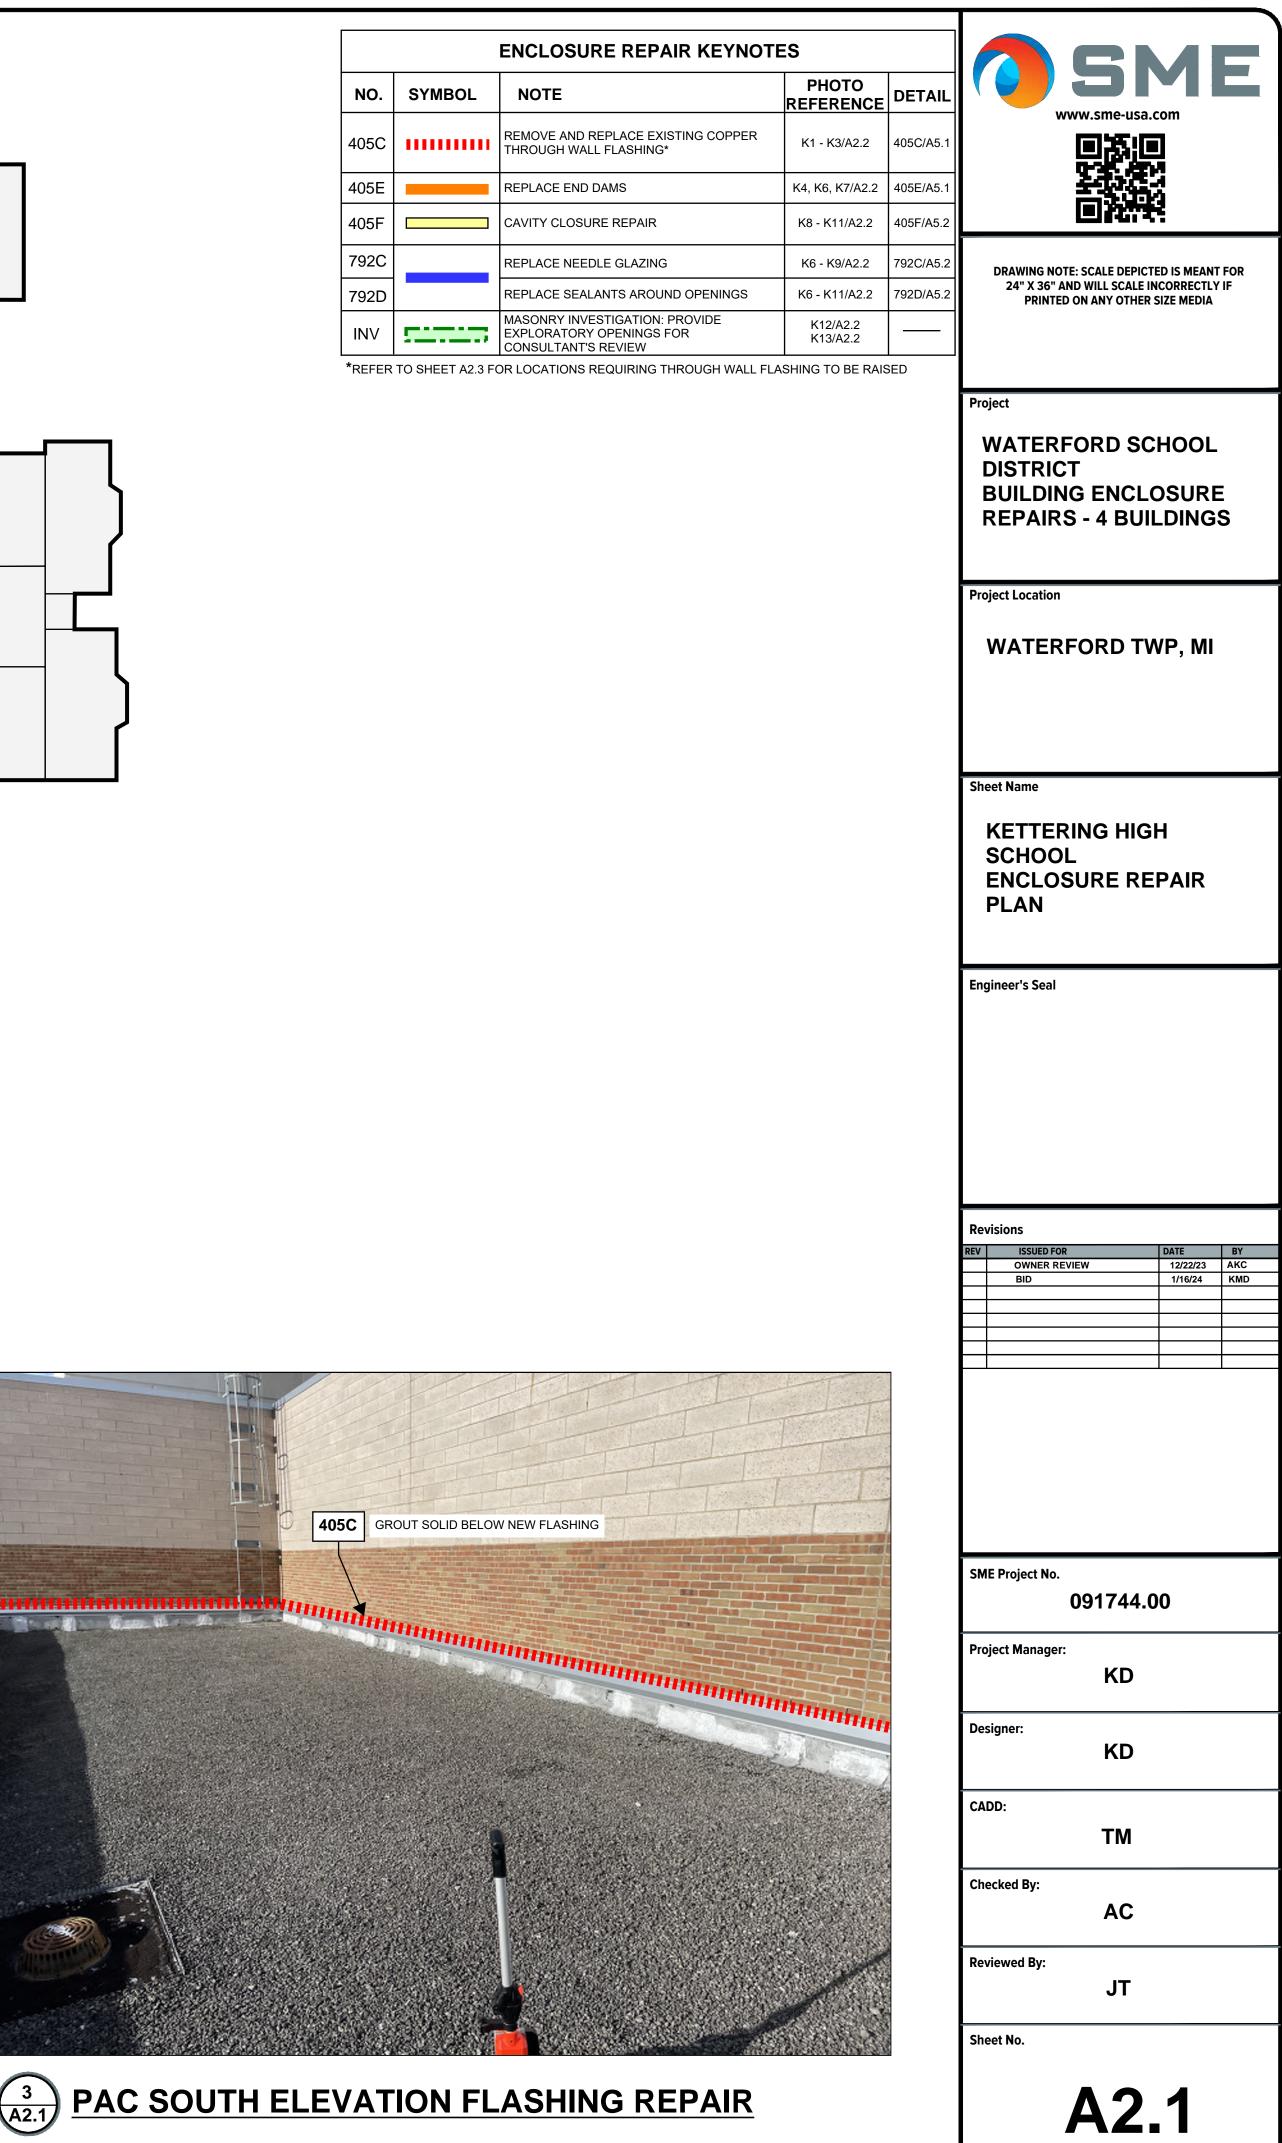



K1 <u>ITEM 405C6 - PAC SOUTH</u> <u>ELEVATION FLASHING REPAIR</u>



K6 <u>ITEMS 405E, 792C, 792D -</u> <u>NATATORIUM SEALANT AND</u> <u>END DAM REPAIR - NORTH</u>





K11 ITEMS 405F, 792C, 792D - SOUTH ENTRANCE CURTAIN WALL INTERIOR VIEW



ITEM 405C6 - PAC SOUTH ELEVATION FLASHING REPAIR **(K2**)



K7 <u>ITEMS 405E, 792C, 792D -</u> <u>NATATORIUM SEALANT AND END</u> <u>DAM REPAIR - SOUTH</u>





) <u>ITEM 405C6 - PAC SOUTH</u> <u>ELEVATION FLASHING REPAIR</u> <u>EXISTING CONDITIONS NO. 3</u>





K3

ITEMS 405F, 792C, 792D - SOUTH ENTRANCE CURTAIN WALL CAVITY CLOSURE AND SEALANT REPAIR





(K13) <u>ITEM INV - PROPOSED</u> EXPLORATORY OPENING LOCATION PAC SOUTH ELEVATION






) <u>ITEMS 405C, 405C4, 405E-</u> <u>NATATORIUM - FLASHING AND END</u> <u>DAM REPAIR</u>






ITEMS 405F, 792C, 792D - SOUTH ENTRANCE CURTAIN WALL CAVITY CLOSURE AND SEALANT REPAIR -CORNER

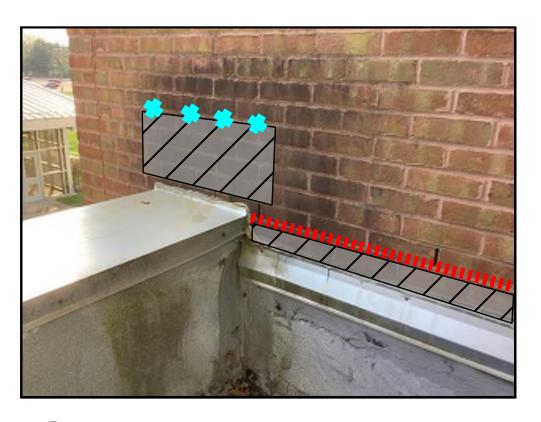


K5 ITEM 405C & 405C4 - NATATORIUM -FLASHING REPAIR

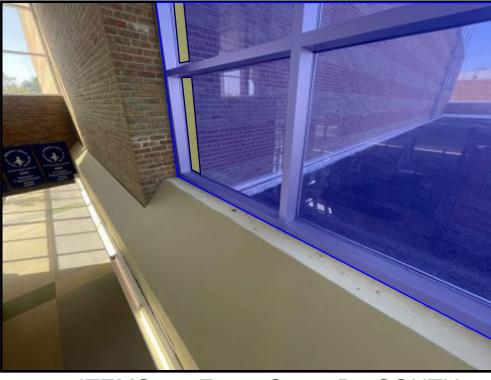


(к10)


ITEMS 405F, 792C, 792D - SOUTH ENTRANCE CURTAIN WALL CAVITY CLOSURE AND SEALANT REPAIR -**INTERIOR VIEW**

	SME www.sme-usa.com				
	DRAWING NOTE: SCALE DEPICTED IS MEANT FOR 24" X 36" AND WILL SCALE INCORRECTLY IF PRINTED ON ANY OTHER SIZE MEDIA				
\ [E	^{ject} NATERFOR DISTRICT BUILDING E REPAIRS - 4	NCLC	OSURE		
	ject Location WATERFOR	D TW	/P, MI		
	eet Name KETTERING SCHOOL ENCLOSUR CONDITION	E REI			
Eng	jineer's Seal				
	visions				
REV	ISSUED FOR OWNER REVIEW BID		DATE 12/22/23 1/16/24	BY AKC KMD	
SM	E Project No.	744.0	0		
Pro	ject Manager:	KD			
Des	signer:	KD			
CA	DD:	ГМ			
Che	ecked By:	AC			
		JT			
She					

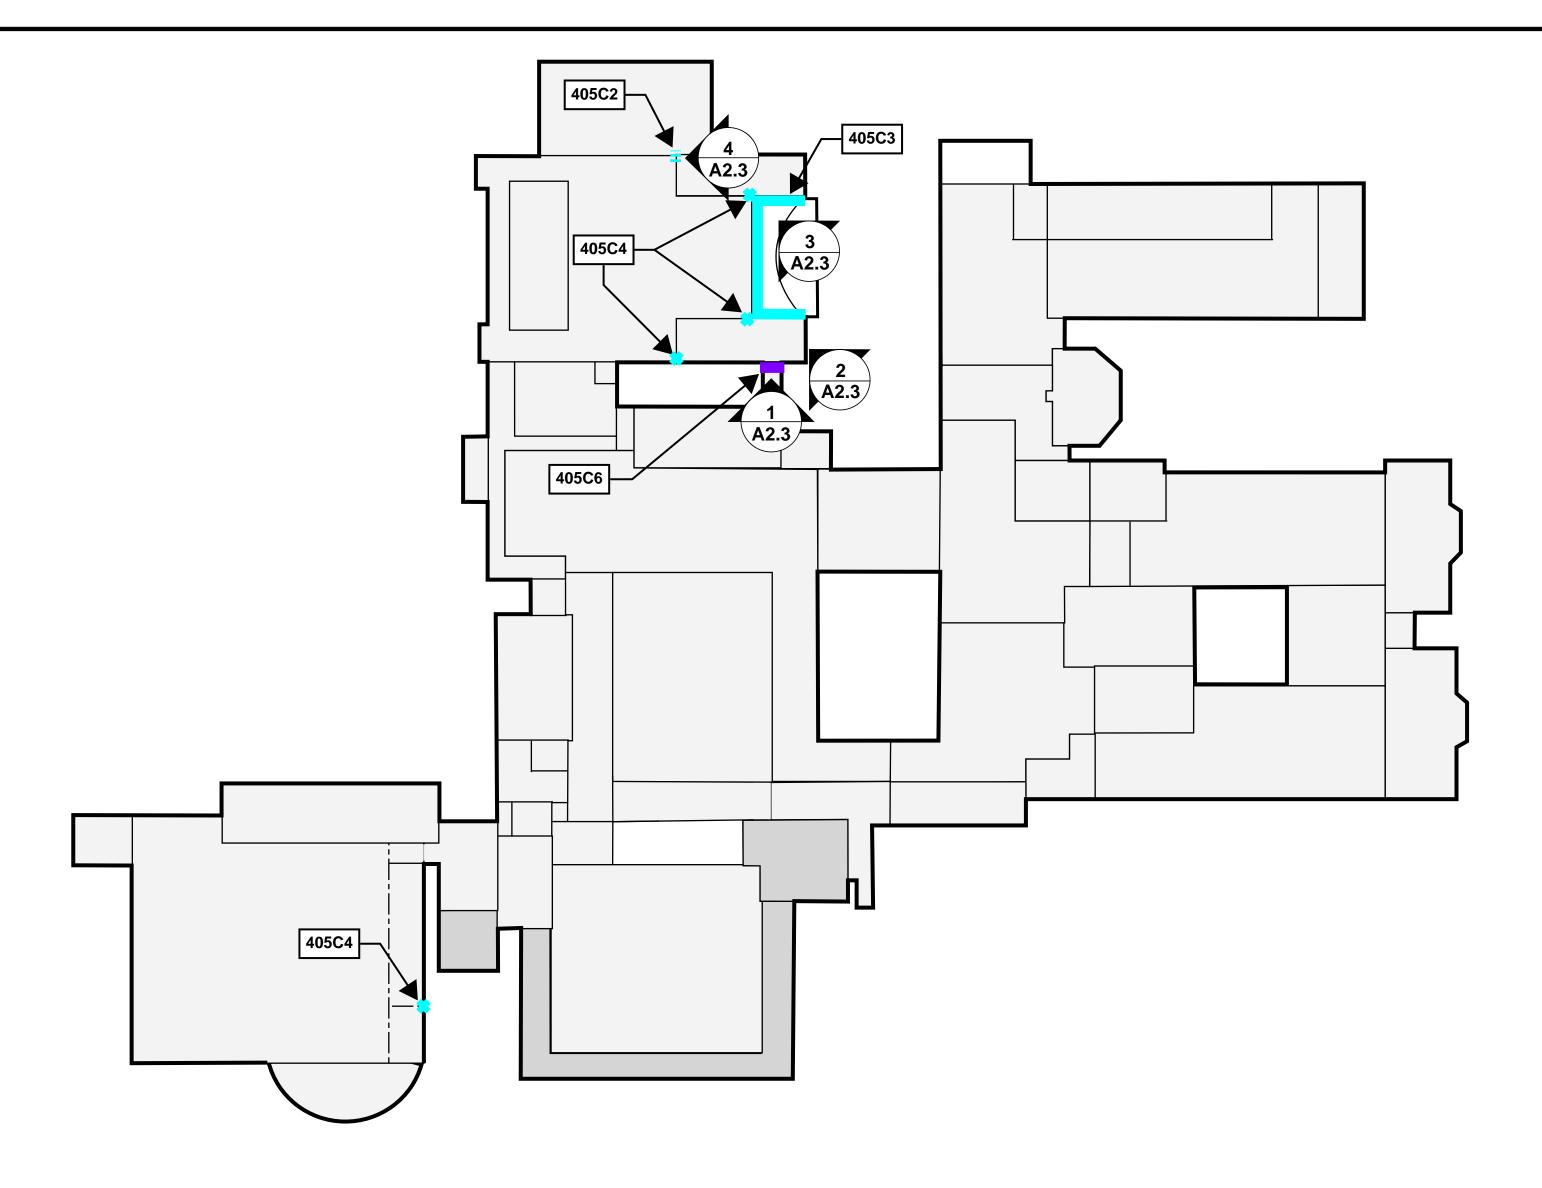

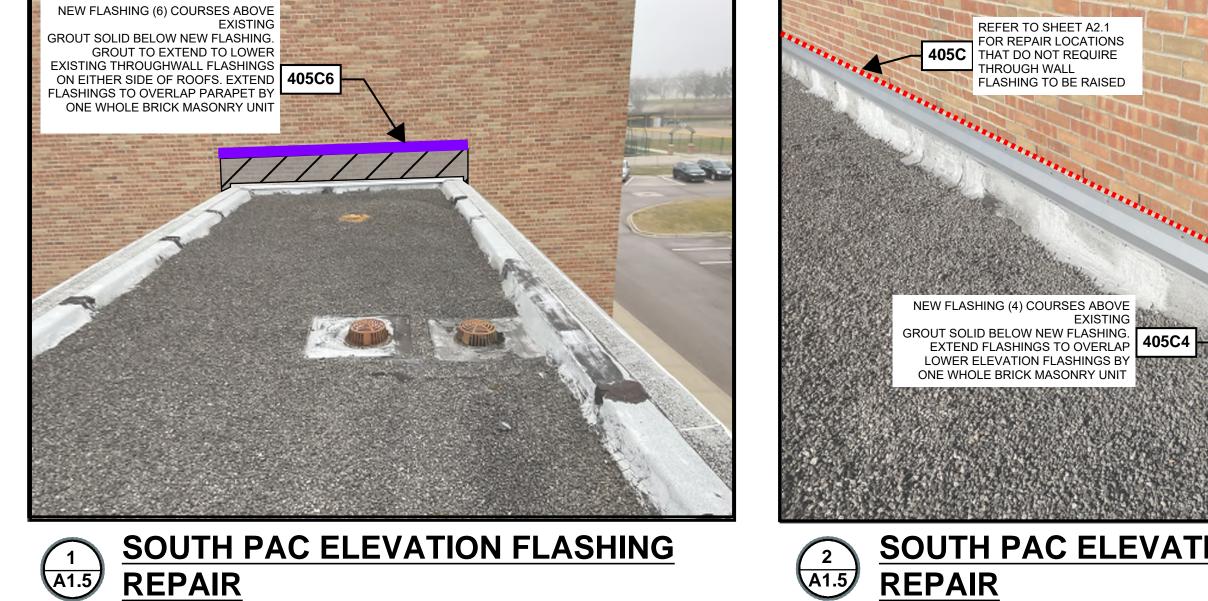





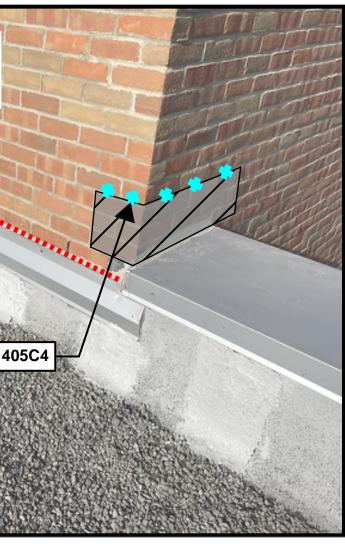

SOUTH PAC ELEVATION FLASHING

REPAIR

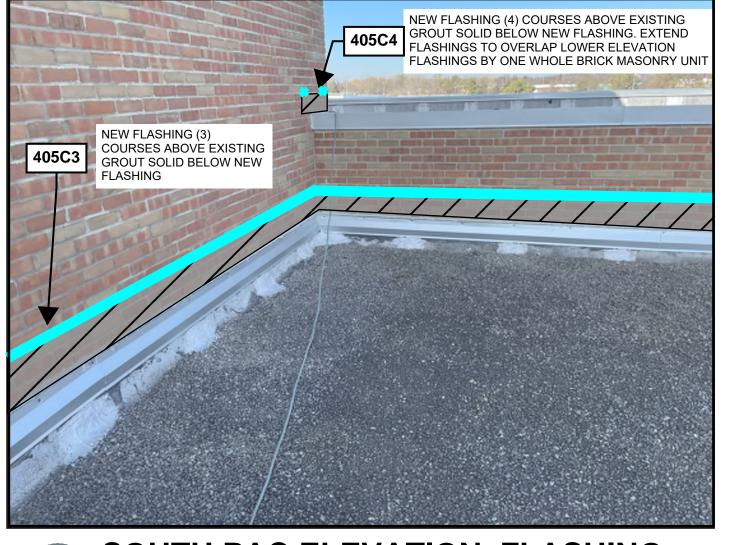


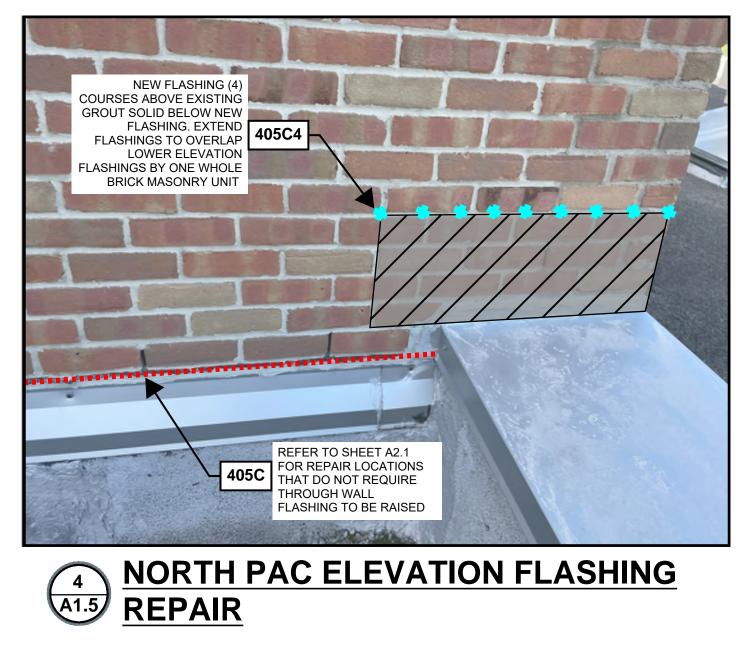



THRO	THROUGH WALL FLASH HEIGHTS KEYNOTES			
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL
405C6		DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 6 COURSES ABOVE EXISTING EXISTING THROUGH WALL FLASHING HEIGHT		405C/A5.1
405C4	*	DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 4 COURSES ABOVE EXISTING THORUGH WALL FLASHING HEIGHT		405C/A5.1
405C3		DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 3 COURSES ABOVE EXISTING THORUGH WALL FLASHING/COUNTERFLASHING HEIGHT		405C/A5.1
405C2		DURING THROUGH WALL FLASHING REPLACEMENT RAISE FLASHING MIN. 2 COURSES ABOVE EXISTING THROUGHWALL FLASHING HEIGHT		405C/A5.1

REFER TO SHEET A2.1 FOR FLASHING REPAIR LOCATIONS THAT DO NOT REQUIRE THROUGH WALL FLASHINGS TO BE RAISED.

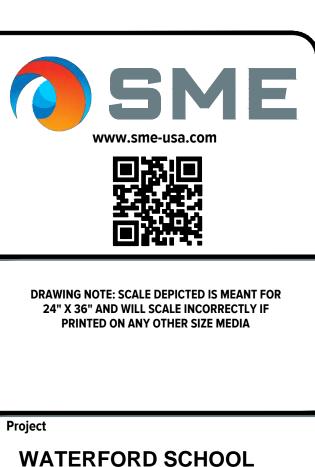

WATERFORD SCHOOL DISTRICT **BUILDING ENCLOSURE REPAIRS - 4 BUILDINGS**


Project Location

WATERFORD TWP, MI

Sheet Name


KETTERING HIGH SCHOOL FLASHING HEIGHT ADJUSTMENT PLAN

Engineer's Seal

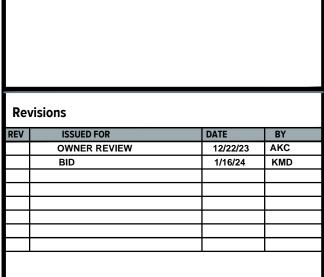

SME Project No.	
09174	4.00
Project Manager:	
KD	
Designer:	
KD	
CADD:	
ТМ	
Checked By:	
AC	;
Reviewed By:	
Sheet No.	
Δ2	2.3

NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME © 2022

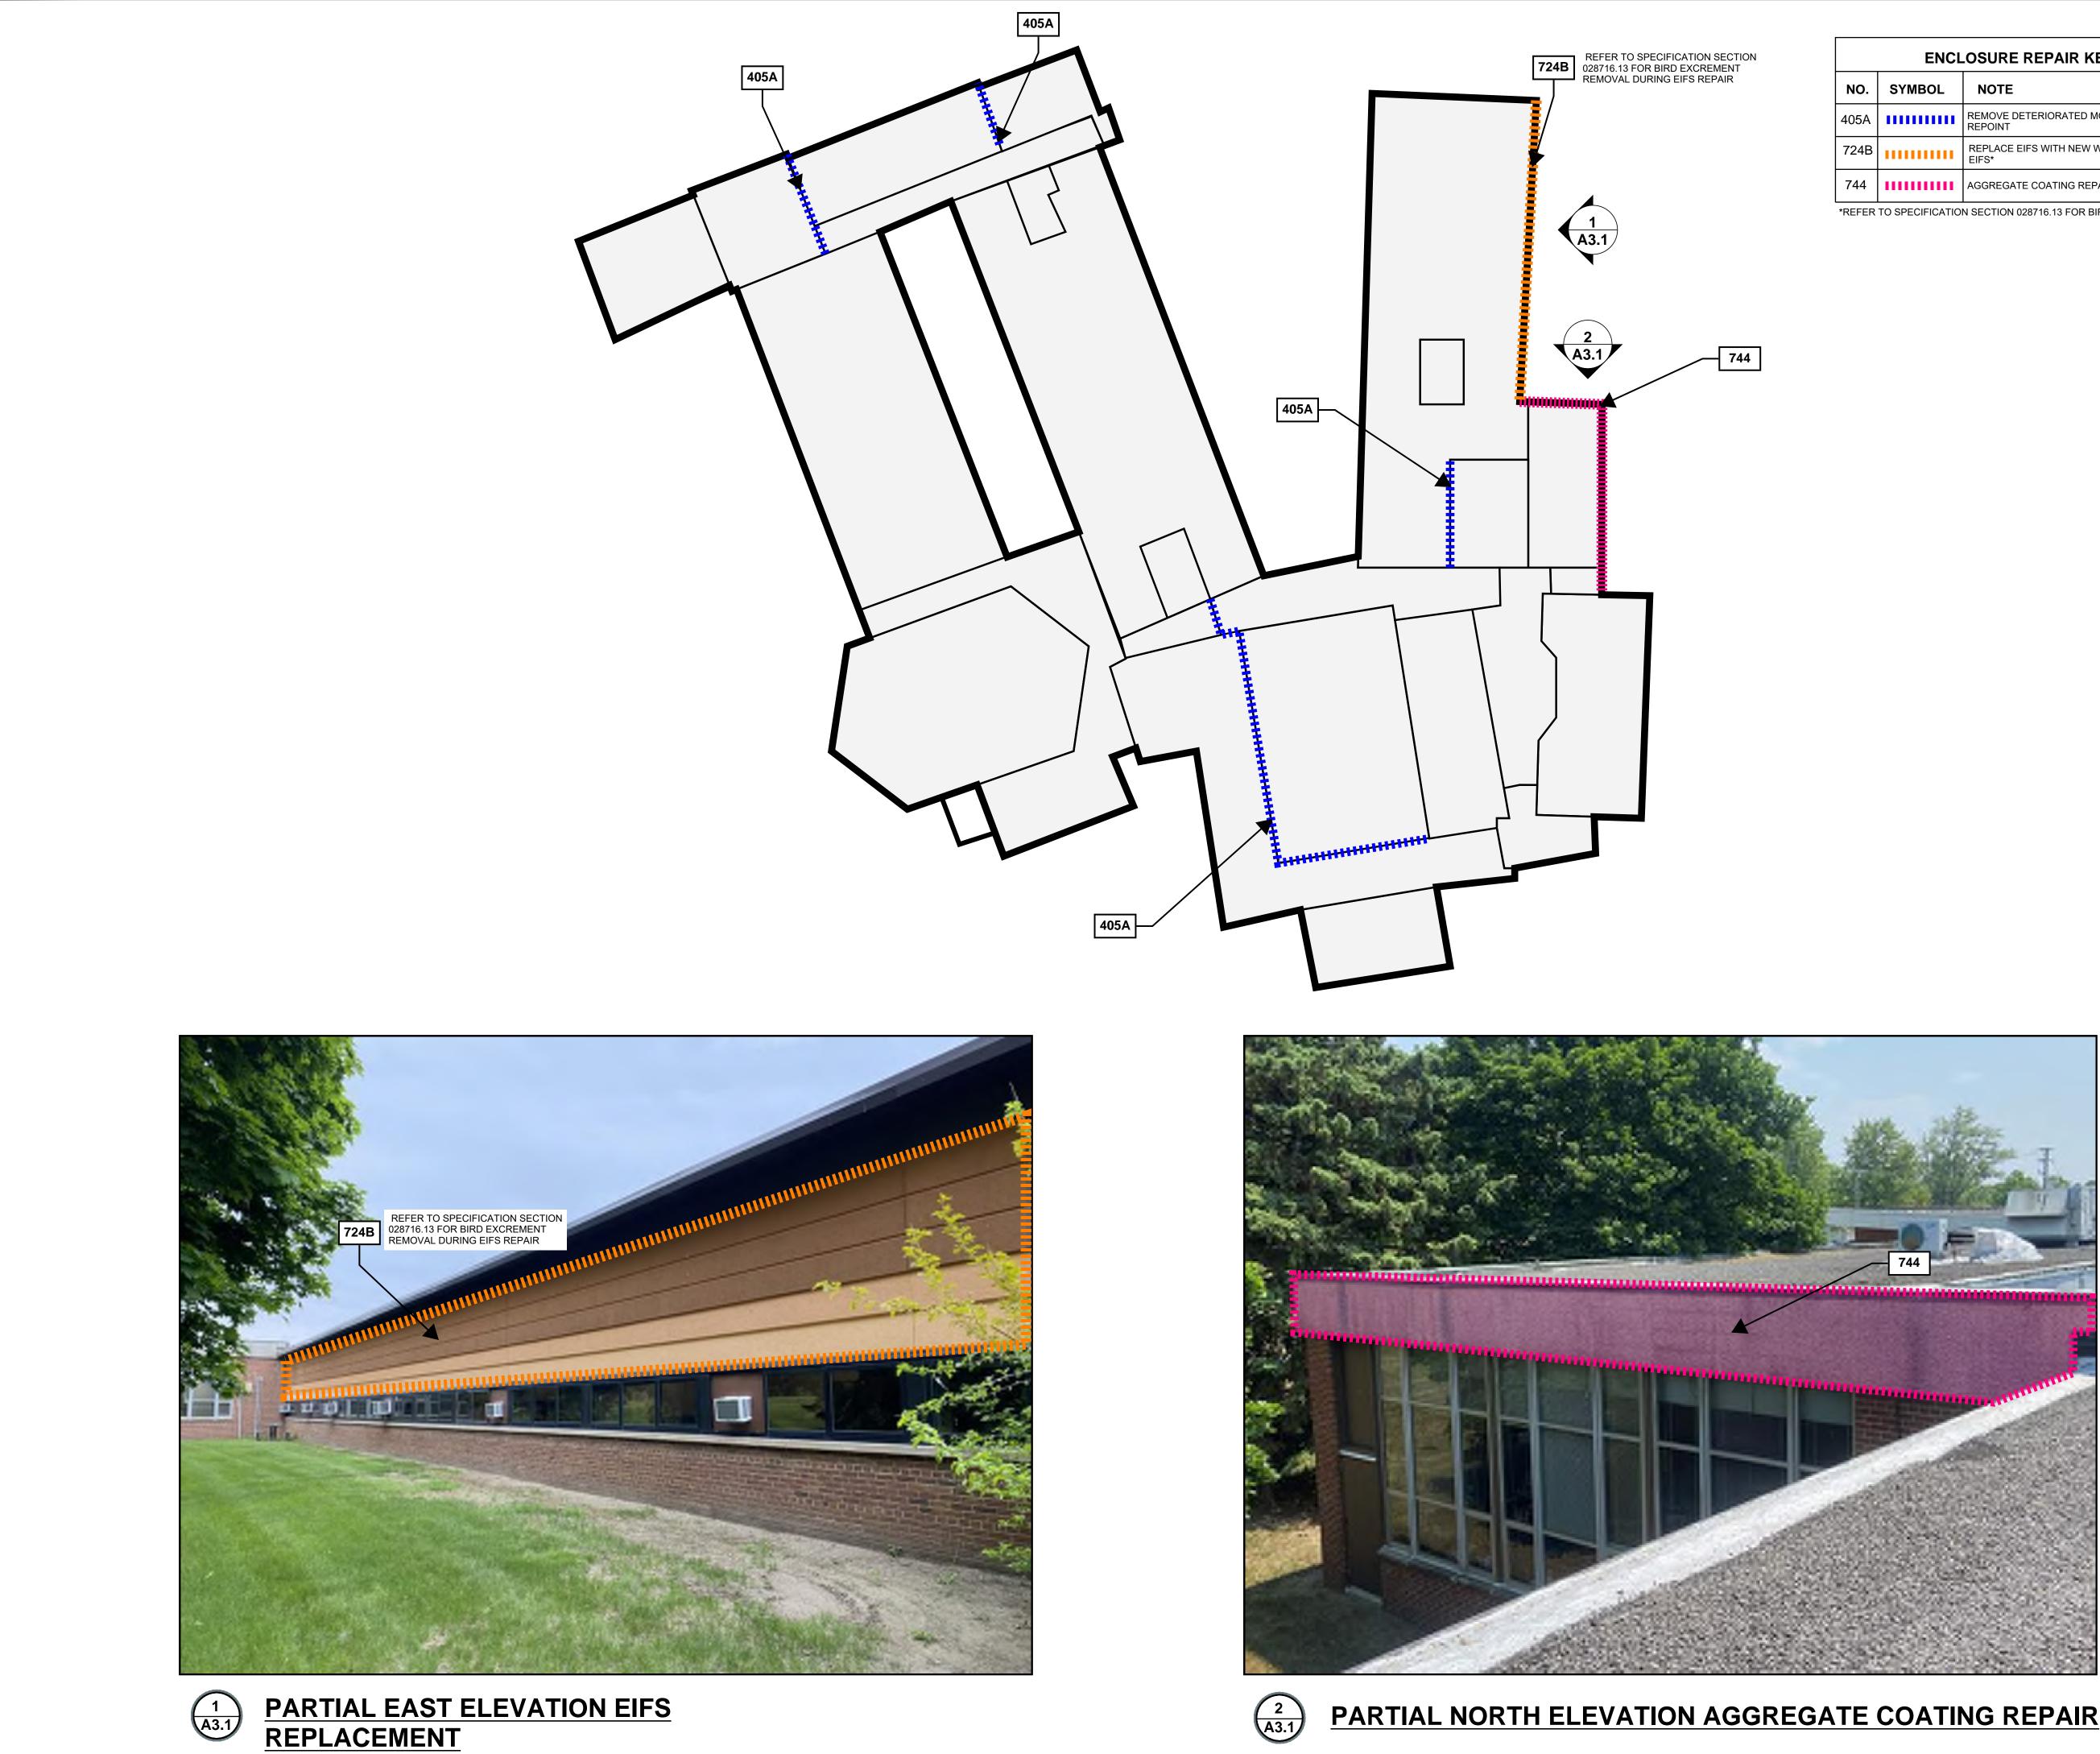





PARTIAL NORTH ELEVATION AGGREGATE COATING REPAIR


	ENCLOSURE REPAIR KEYNOTES					
0.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL		
5A		REMOVE DETERIORATED MORTAR AND REPOINT	C4/A3.3	405A/A5.1		
4B		REPLACE EIFS WITH NEW WATER-MANAGED EIFS*	C1/A3.3 C2/A3.3	724B/A5.1		
4		AGGREGATE COATING REPAIR	C3/A3.3	744/A5.2		

*REFER TO SPECIFICATION SECTION 028716.13 FOR BIRD EXCREMENT REMOVAL AT EIFS

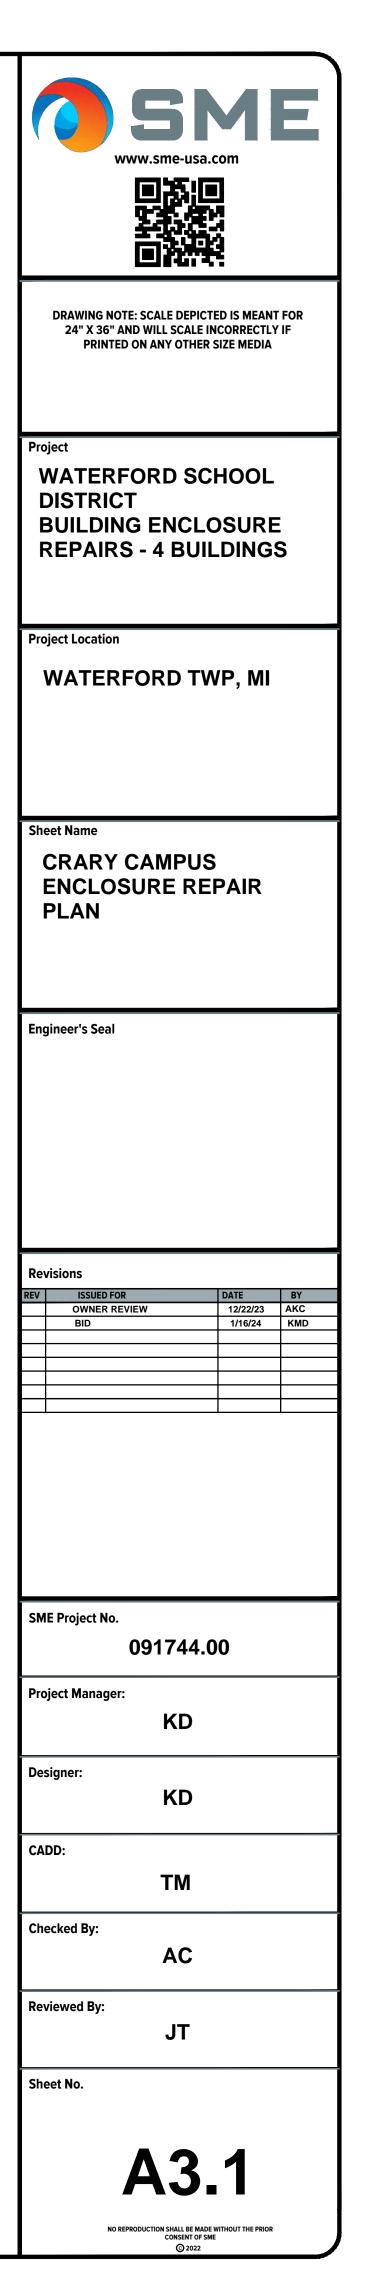




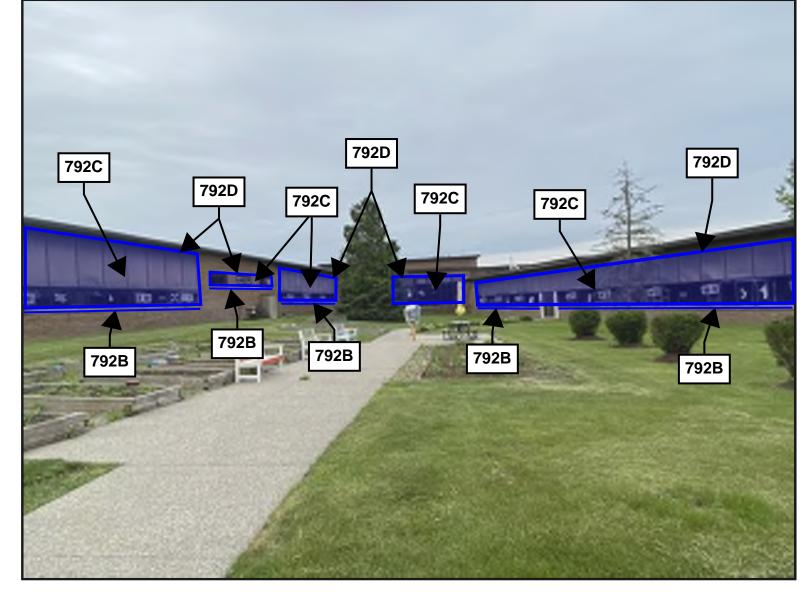


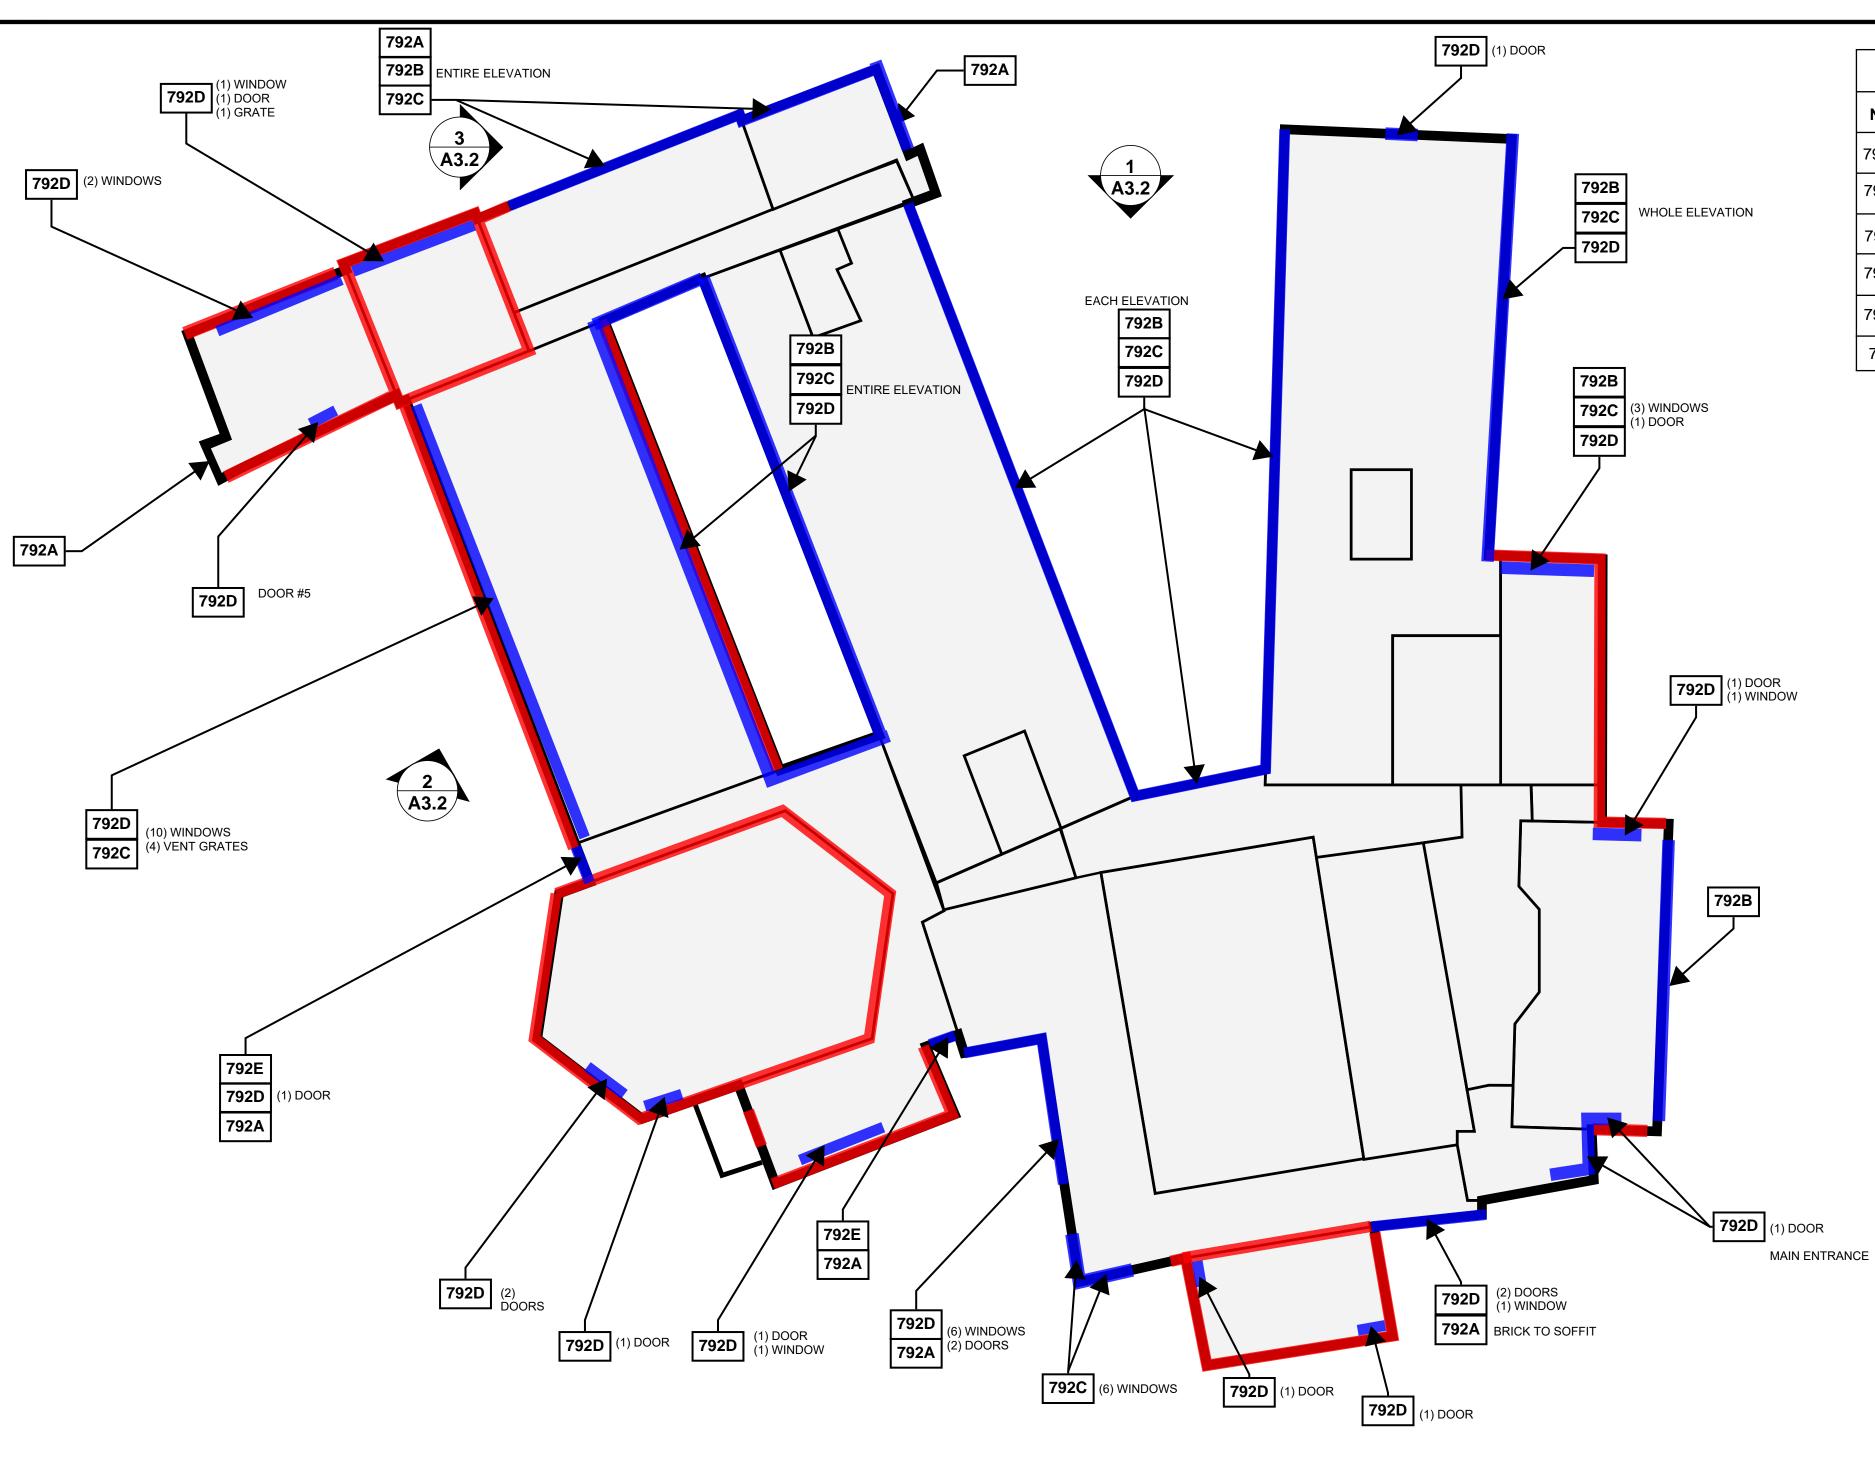



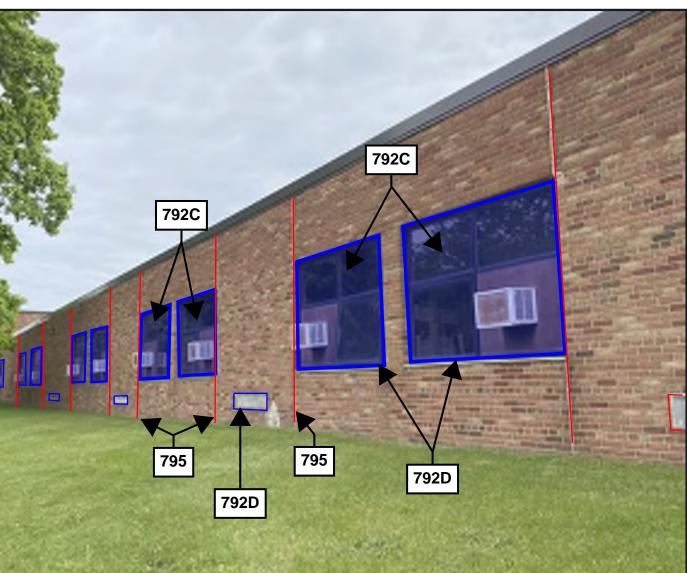

PARTIAL WEST ELEVATION SEALANT REPLACEMENT

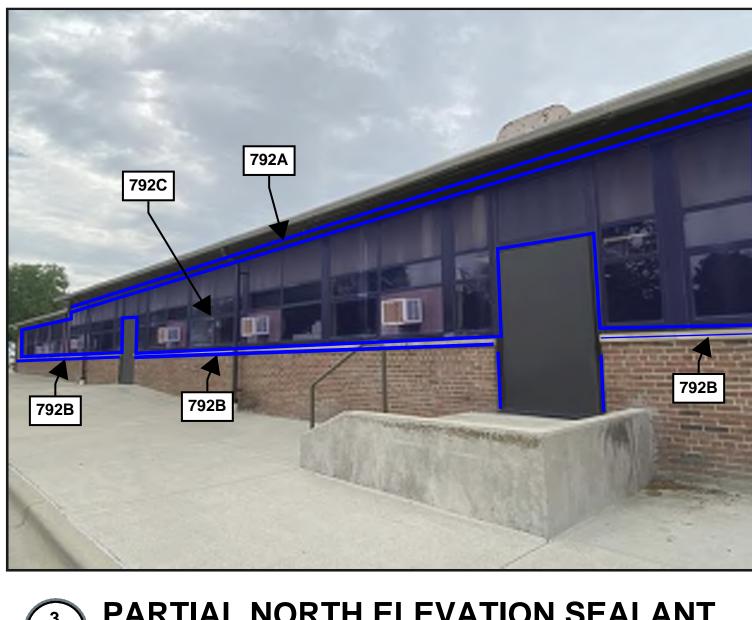



	ENCLOSURE REPAIR KEYNOTES					
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL		
792A		REPLACE SEALANTS AT THE INTERFACE OF DISSIMILAR MATERIALS	C6/A3.3 C7/A3.3	792A/A5.2		
792B		REPLACE PRECAST WINDOWSILL SEALANT	C13/A3.3	792B/A5.2		
792C		REPLACE NEEDLE GLAZING	C8/A3.3 C9/A3.3	792C/A5.2		
792D		REPLACE SEALANTS AROUND OPENINGS	C10 - C12/A3.3	792D/A5.2		
792E		REPLACE PRECAST PANEL SEALANTS	C14/A3.3	792E/A5.2		
795		REPLACE BRICK EXPANSION JOINT SEALANT	C5/A3.3	795/A5.2		



(3) A3.2 PARTIAL NORTH ELEVATION SEALANT REPLACEMENT

	DRAWING NOTE: SCALE DEPICTED IS MEANT FOR 24" X 36" AND WILL SCALE INCORRECTLY IF PRINTED ON ANY OTHER SIZE MEDIA				
V C E	DISTRIC ⁻ BUILDIN	ORD SC T G ENCLC S - 4 BUIL	OSURE		
	oject Location	FORD TW	/P, MI		
(eet Name CRARY (SEALAN REPAIR	-			
Eng	gineer's Seal				
Re	visions				
REV	ISSUED FOR OWNER RE		DATE 12/22/23	BY AKC	
	BID		1/16/24	KMD	
			1		
SM	IE Project No.)91744.00	D		
Pro	oject Manager:	KD			
De	signer:	KD			
CA	DD:	ТМ			
Ch	ecked By:	AC			
	viewed By:	JT			
Sh	JT				
511	eet No.				

NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME © 2022







ITEM 724B - EIFS REPLACEMENT






ITEM 792A - SEALANT REPLACEMENT AT DISSIMILAR MATERIALS -BRICK-TO-SOFFIT JOINTS






C12 <u>AROUND OPENINGS - UNSEALED</u> <u>PENETRATION</u>

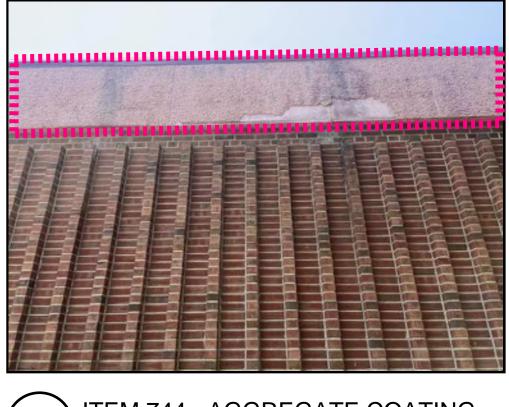

) <u>ITEM 744 - AGGREGATE COATING</u> <u>REPAIR</u> **C**3

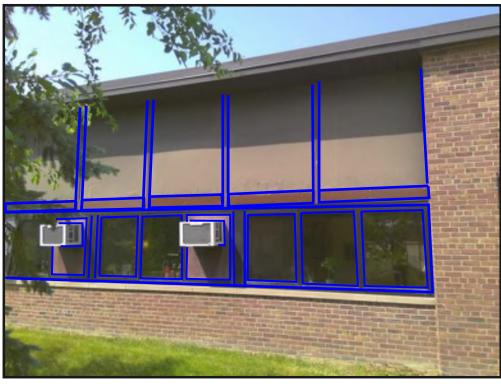



ITEM 792C - NEEDLE GLAZING REPLACEMENT AT NORTH COURTYARD WINDOWS





C13 <u>ITEM 792B - SEALANT</u> <u>REPLACEMENT AT PRECAST SILL</u> <u>JOINTS</u>







ITEM 405A - BRICK REPOINTING





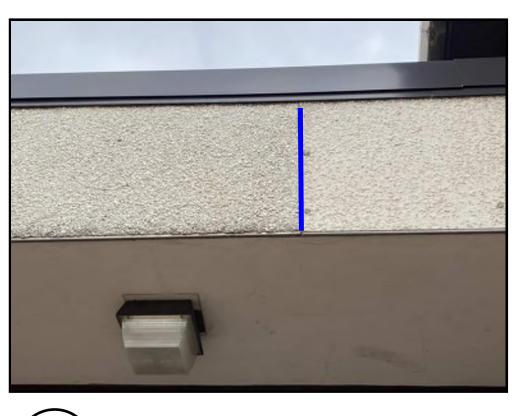

C14 <u>ITEM 792E - PRECAST PANEL</u> <u>SEALANT REPLACEMENT</u>

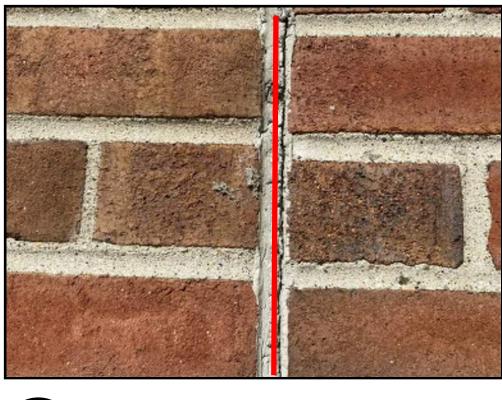



) <u>ITEM 795 - EXPANSION JOINT</u> <u>SEALANT REPLACEMENT</u> C5




(C10) <u>ITEM 792D - SEALANT</u> <u>REPLACEMENT AROUND</u> **OPENINGS**

	SAME www.sme-usa.com			
	DRAWING NOTE: SCALE DEPICTE 24" X 36" AND WILL SCALE IN PRINTED ON ANY OTHER S	CORRECTLY		
V E F	^{ject} NATERFORD SCI DISTRICT BUILDING ENCLC REPAIRS - 4 BUIL	SURE		
,	ject Location	/P, MI		
	eet Name CRARY CAMPUS ENCLOSURE ANI SEALANT REPAI CONDITIONS	D		
Eng	jineer's Seal			
	visions			
REV	ISSUED FOR OWNER REVIEW BID	DATE 12/22/23 1/16/24	BY AKC KMD	
SM	E Project No.			
	091744.0	0		
	KD			
De	Designer: KD			
CA	CADD: TM			
Ch	ecked By: AC			
Rev	viewed By: JT			
Sh	eet No.			
	A3.3			
	NO REPRODUCTION SHALL BE MADE V CONSENT OF SME © 2022			

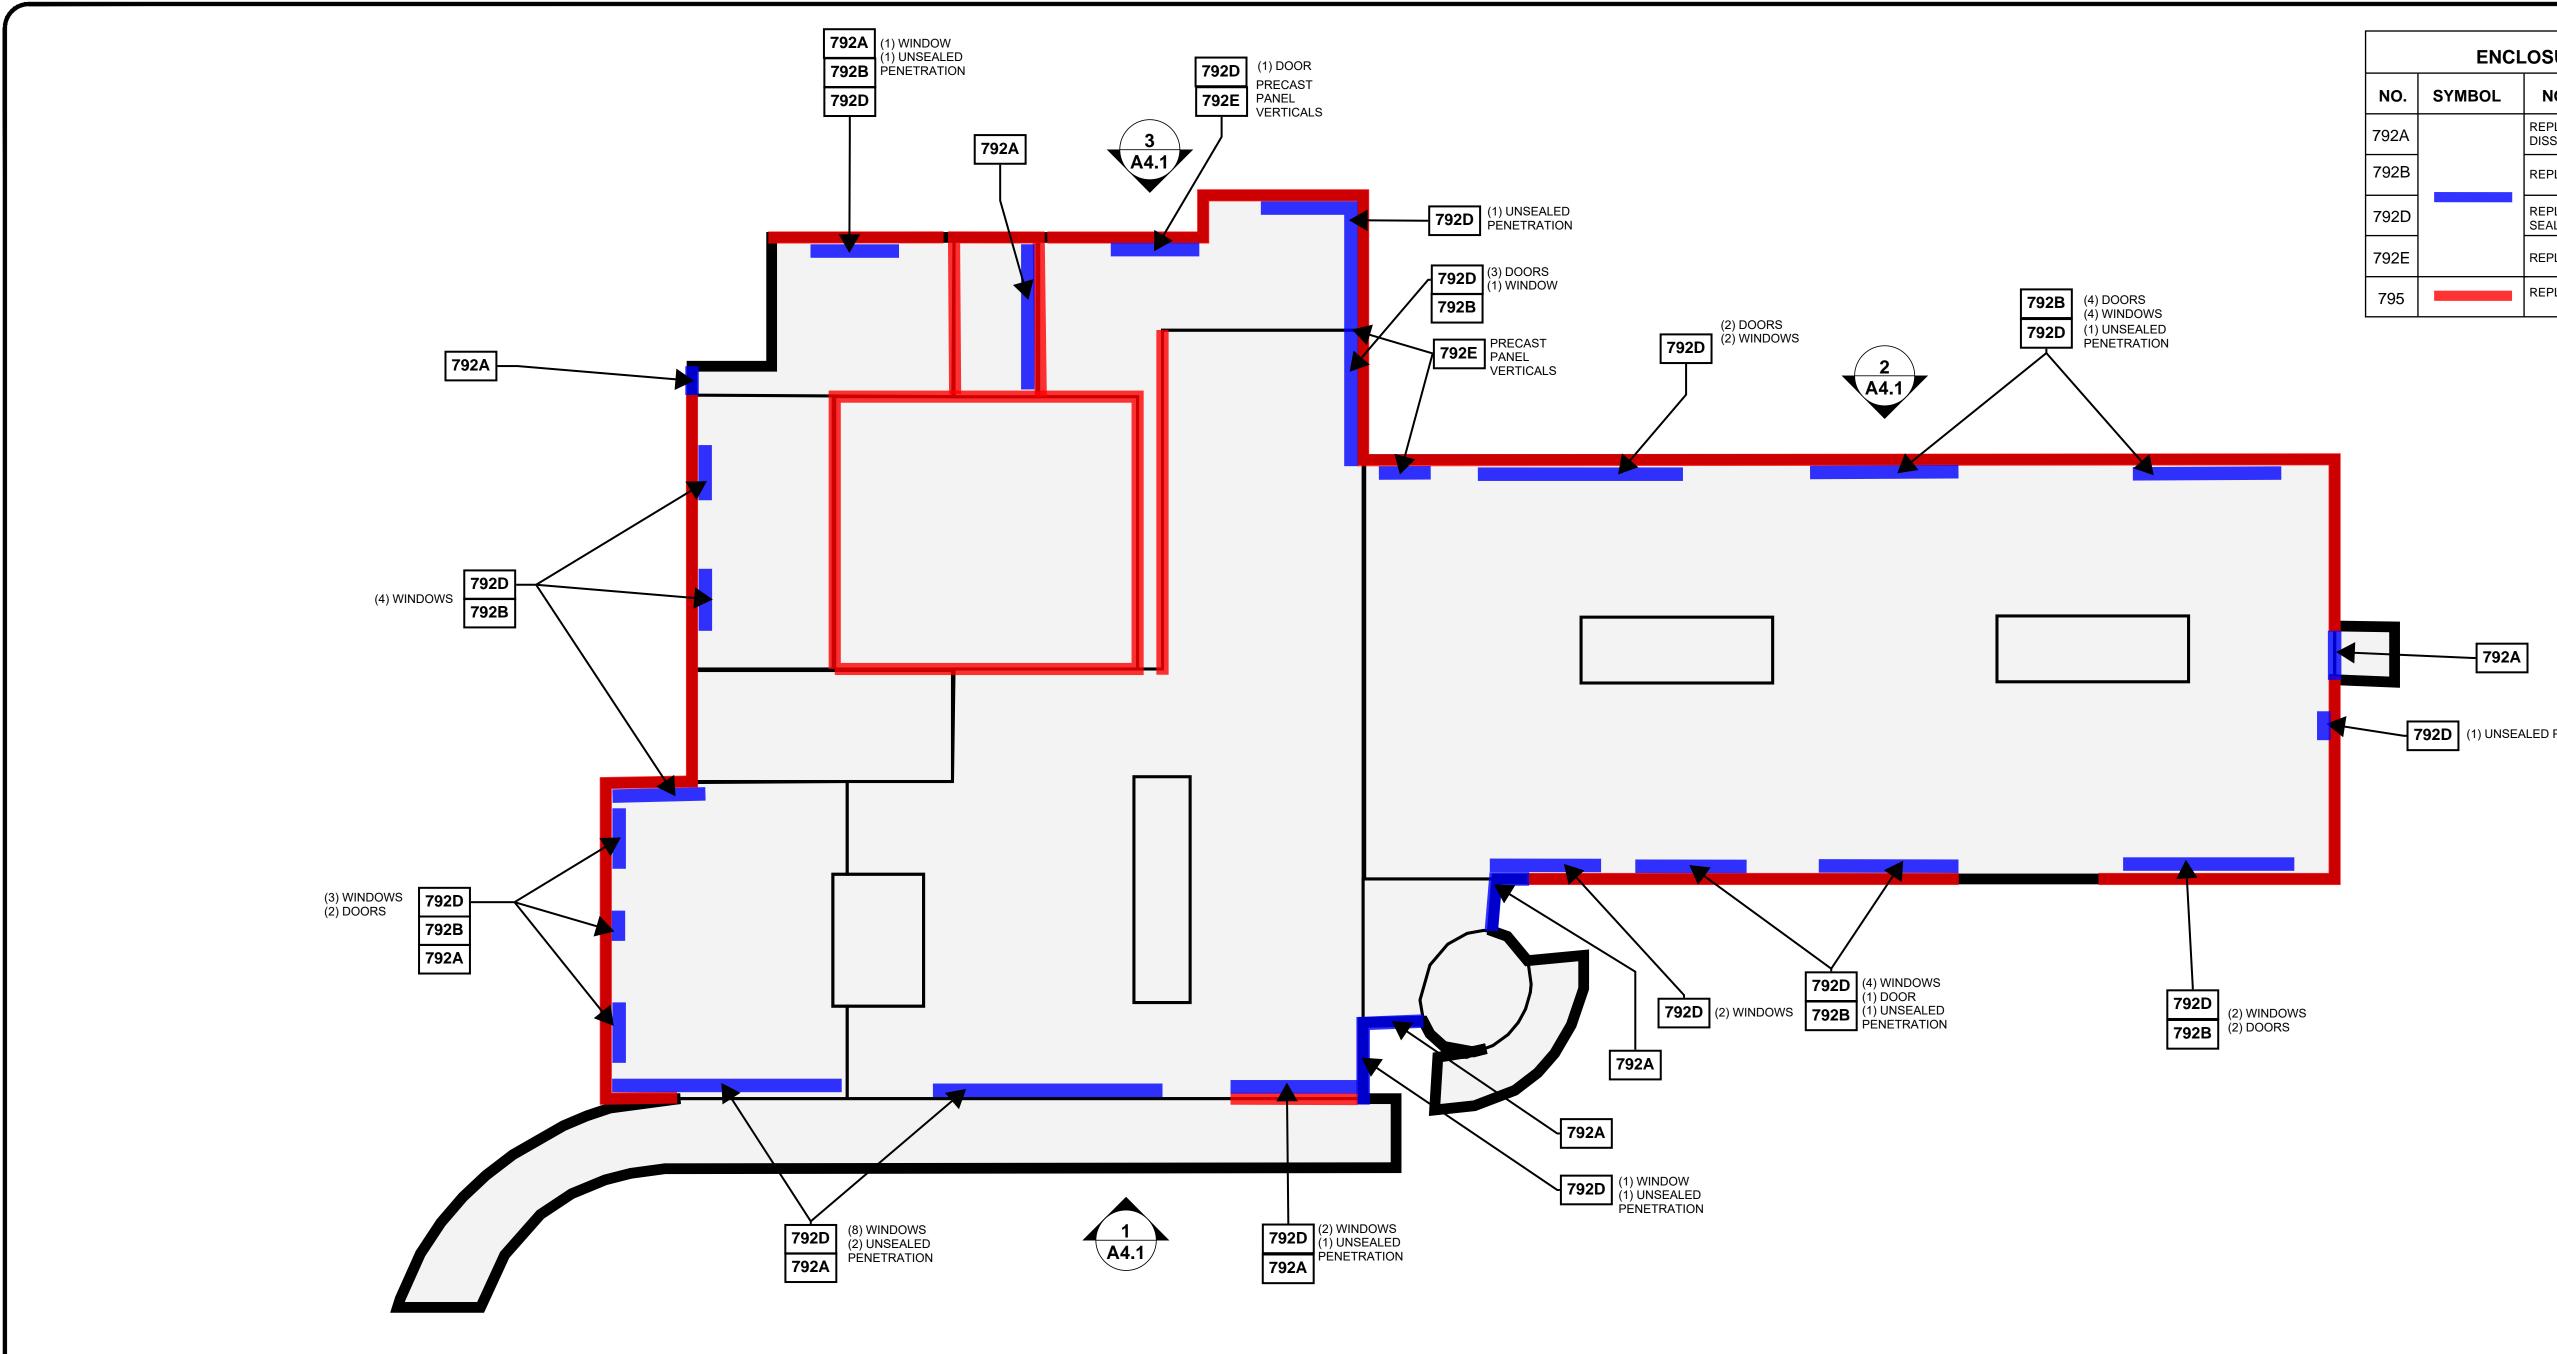


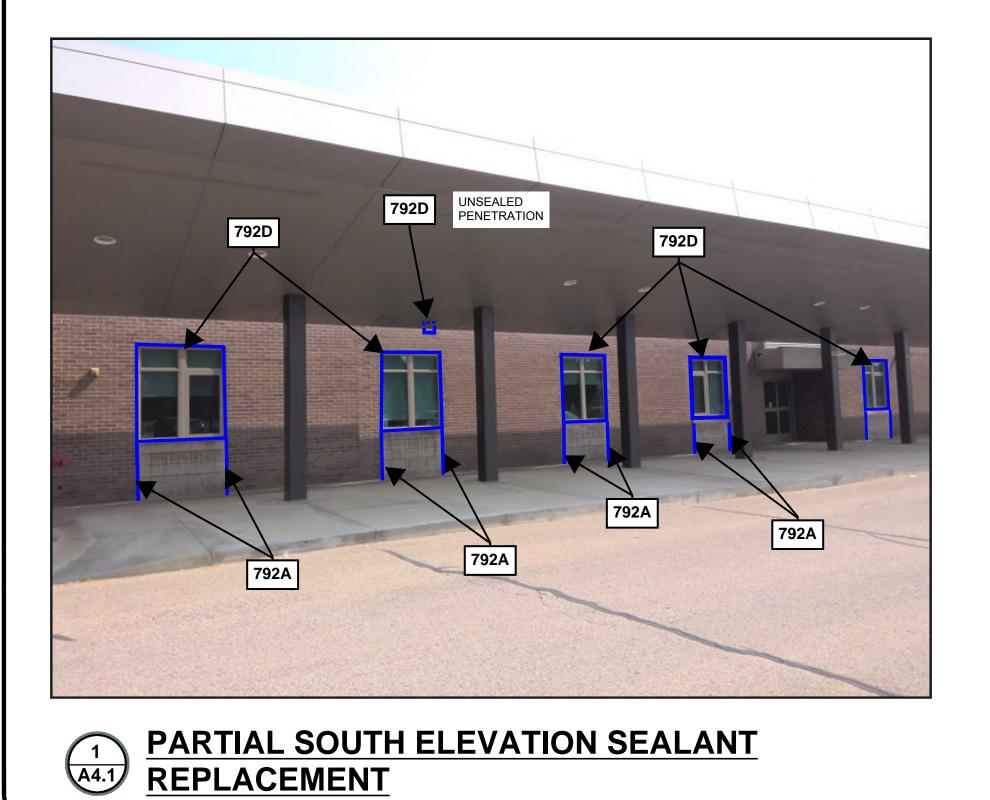

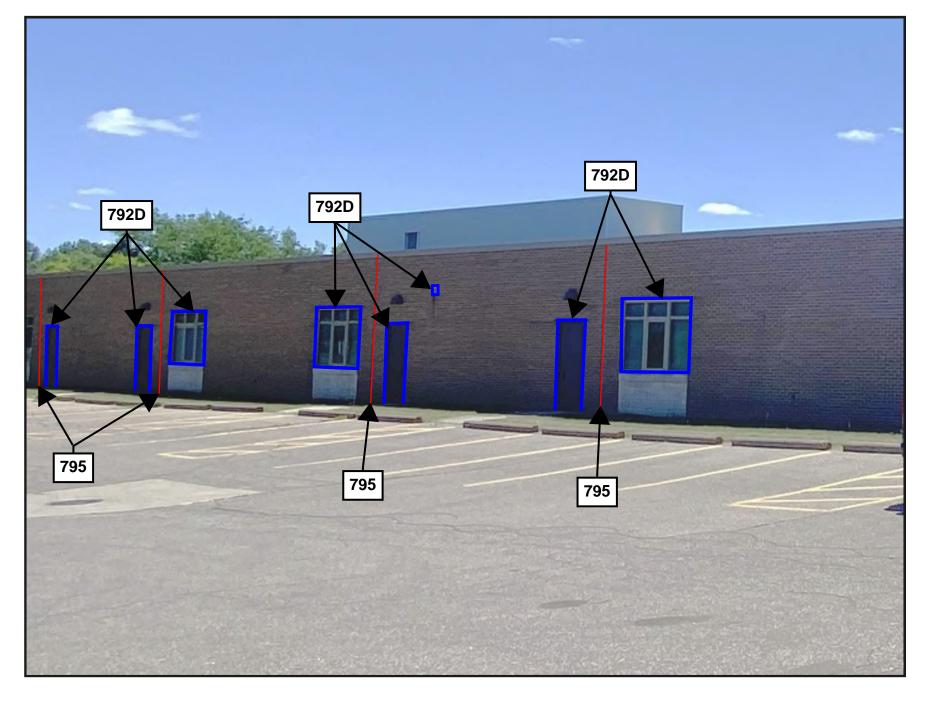

2 A4.1

PARTIAL NORTH ELEVATION SEALANT REPLACEMENT

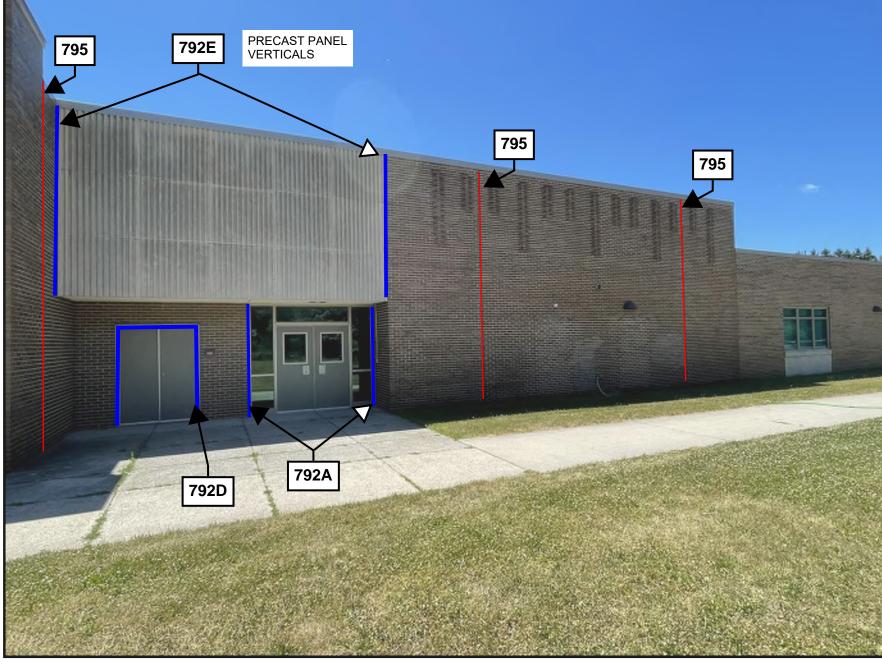



	ENCLOSURE REPAIR KEYNOTES					
NO.	SYMBOL	NOTE	PHOTO REFERENCE	DETAIL		
792A		REPLACE SEALANTS AT INTERFACE OF DISSIMILAR MATERIALS	KM4/A4.2	792A/5.2		
792B		REPLACE PRECAST WINDOWSILL SEALANT	KM6/A4.2	792B/A5.2		
792D		REPLACE PERIMETER AND PENETRATION SEALANTS	KM1 - KM3/A4.2	792D/A5.2		
792E		REPLACE PRECAST PANEL SEALANTS	KM5/A4.2	792E/A5.2		
795		REPLACE BRICK EXPANSION JOINT SEALANT	KM7/A4.2	795/A5.2		



DRAWING NOTE: SCALE DEPICTED IS MEANT FOR 24" X 36" AND WILL SCALE INCORRECTLY IF PRINTED ON ANY OTHER SIZE MEDIA

Project

WATERFORD SCHOOL DISTRICT **BUILDING ENCLOSURE REPAIRS - 4 BUILDINGS**

Project Location

WATERFORD TWP, MI

Sheet Name

KINGSLEY MONTGOMERY SCHOOL SEALANT REPAIR PLAN

Engineer's Seal

Rev	Revisions				
REV	ISSUED FOR	DATE	BY		
REV	ISSUED FOR OWNER REVIEW	DATE 12/22/23	BY AKC		
REV					
REV	OWNER REVIEW	12/22/23	АКС		
REV	OWNER REVIEW	12/22/23	АКС		
REV	OWNER REVIEW	12/22/23	АКС		
REV	OWNER REVIEW	12/22/23	АКС		
REV	OWNER REVIEW	12/22/23	АКС		

SME Project No.



	KD	
signer:	KD	

DD:		
	ТМ	

Checked By: AC

Reviewed By:

Sheet No.

CAI



JT

792D (1) UNSEALED PENETRATION

PARTIAL NORTH ELEVATION SEALANT






KM2 ITEM 792D - SEALANT REPLACEMENT AT UNSEALED PENETRATIONS





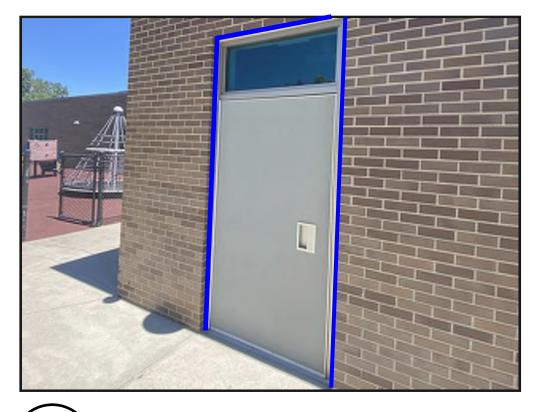



ITEM 792D - SEALANT REPLACEMENT AT DOOR PERIMETER



KM4 <u>ITEM 792A - SEALANT</u> <u>REPLACEMENT AT DISSIMILAR</u> <u>MATERIALS - BRICK-TO-STONE</u> JOINTS


-	-		
1			
i		l	
-		ł	
_		1	
	L		
-			
T			
1	-		
	/		
1	_		
-	-	1	
	ĩ	i	
Ē	ŝ		
ŝ	Ę		
	ş		
		1	
		l	

ITEM 792E - SEALANT




KM5 <u>REPLACEMENT AT DISSIMILAR</u> <u>MATERIALS - PRECAST PANEL</u> JOINTS


www.sme-usa.c	som	Ε
DRAWING NOTE: SCALE DEPICTE 24" X 36" AND WILL SCALE IN PRINTED ON ANY OTHER S	CORRECTLY	
Project WATERFORD SC DISTRICT BUILDING ENCLO REPAIRS - 4 BUII	DSURE	E
Project Location WATERFORD TV	VP, MI	
Sheet Name KINGSLEY MON SCHOOL SEALA REPAIR CONDIT	NT	ERY
Engineer's Seal		
Revisions		
REV ISSUED FOR OWNER REVIEW	DATE 12/22/23	BY AKC
BID	1/16/24	KMD
SME Project No.		
091744.0 Project Manager:	0	
KD Designer:		
KD CADD:		
ТМ		
Checked By:		
Reviewed By: JT		
Sheet No.		
A4 .	2	
NO REPRODUCTION SHALL BE MADE V CONSENT OF SME	VITHOUT THE PRIOR	

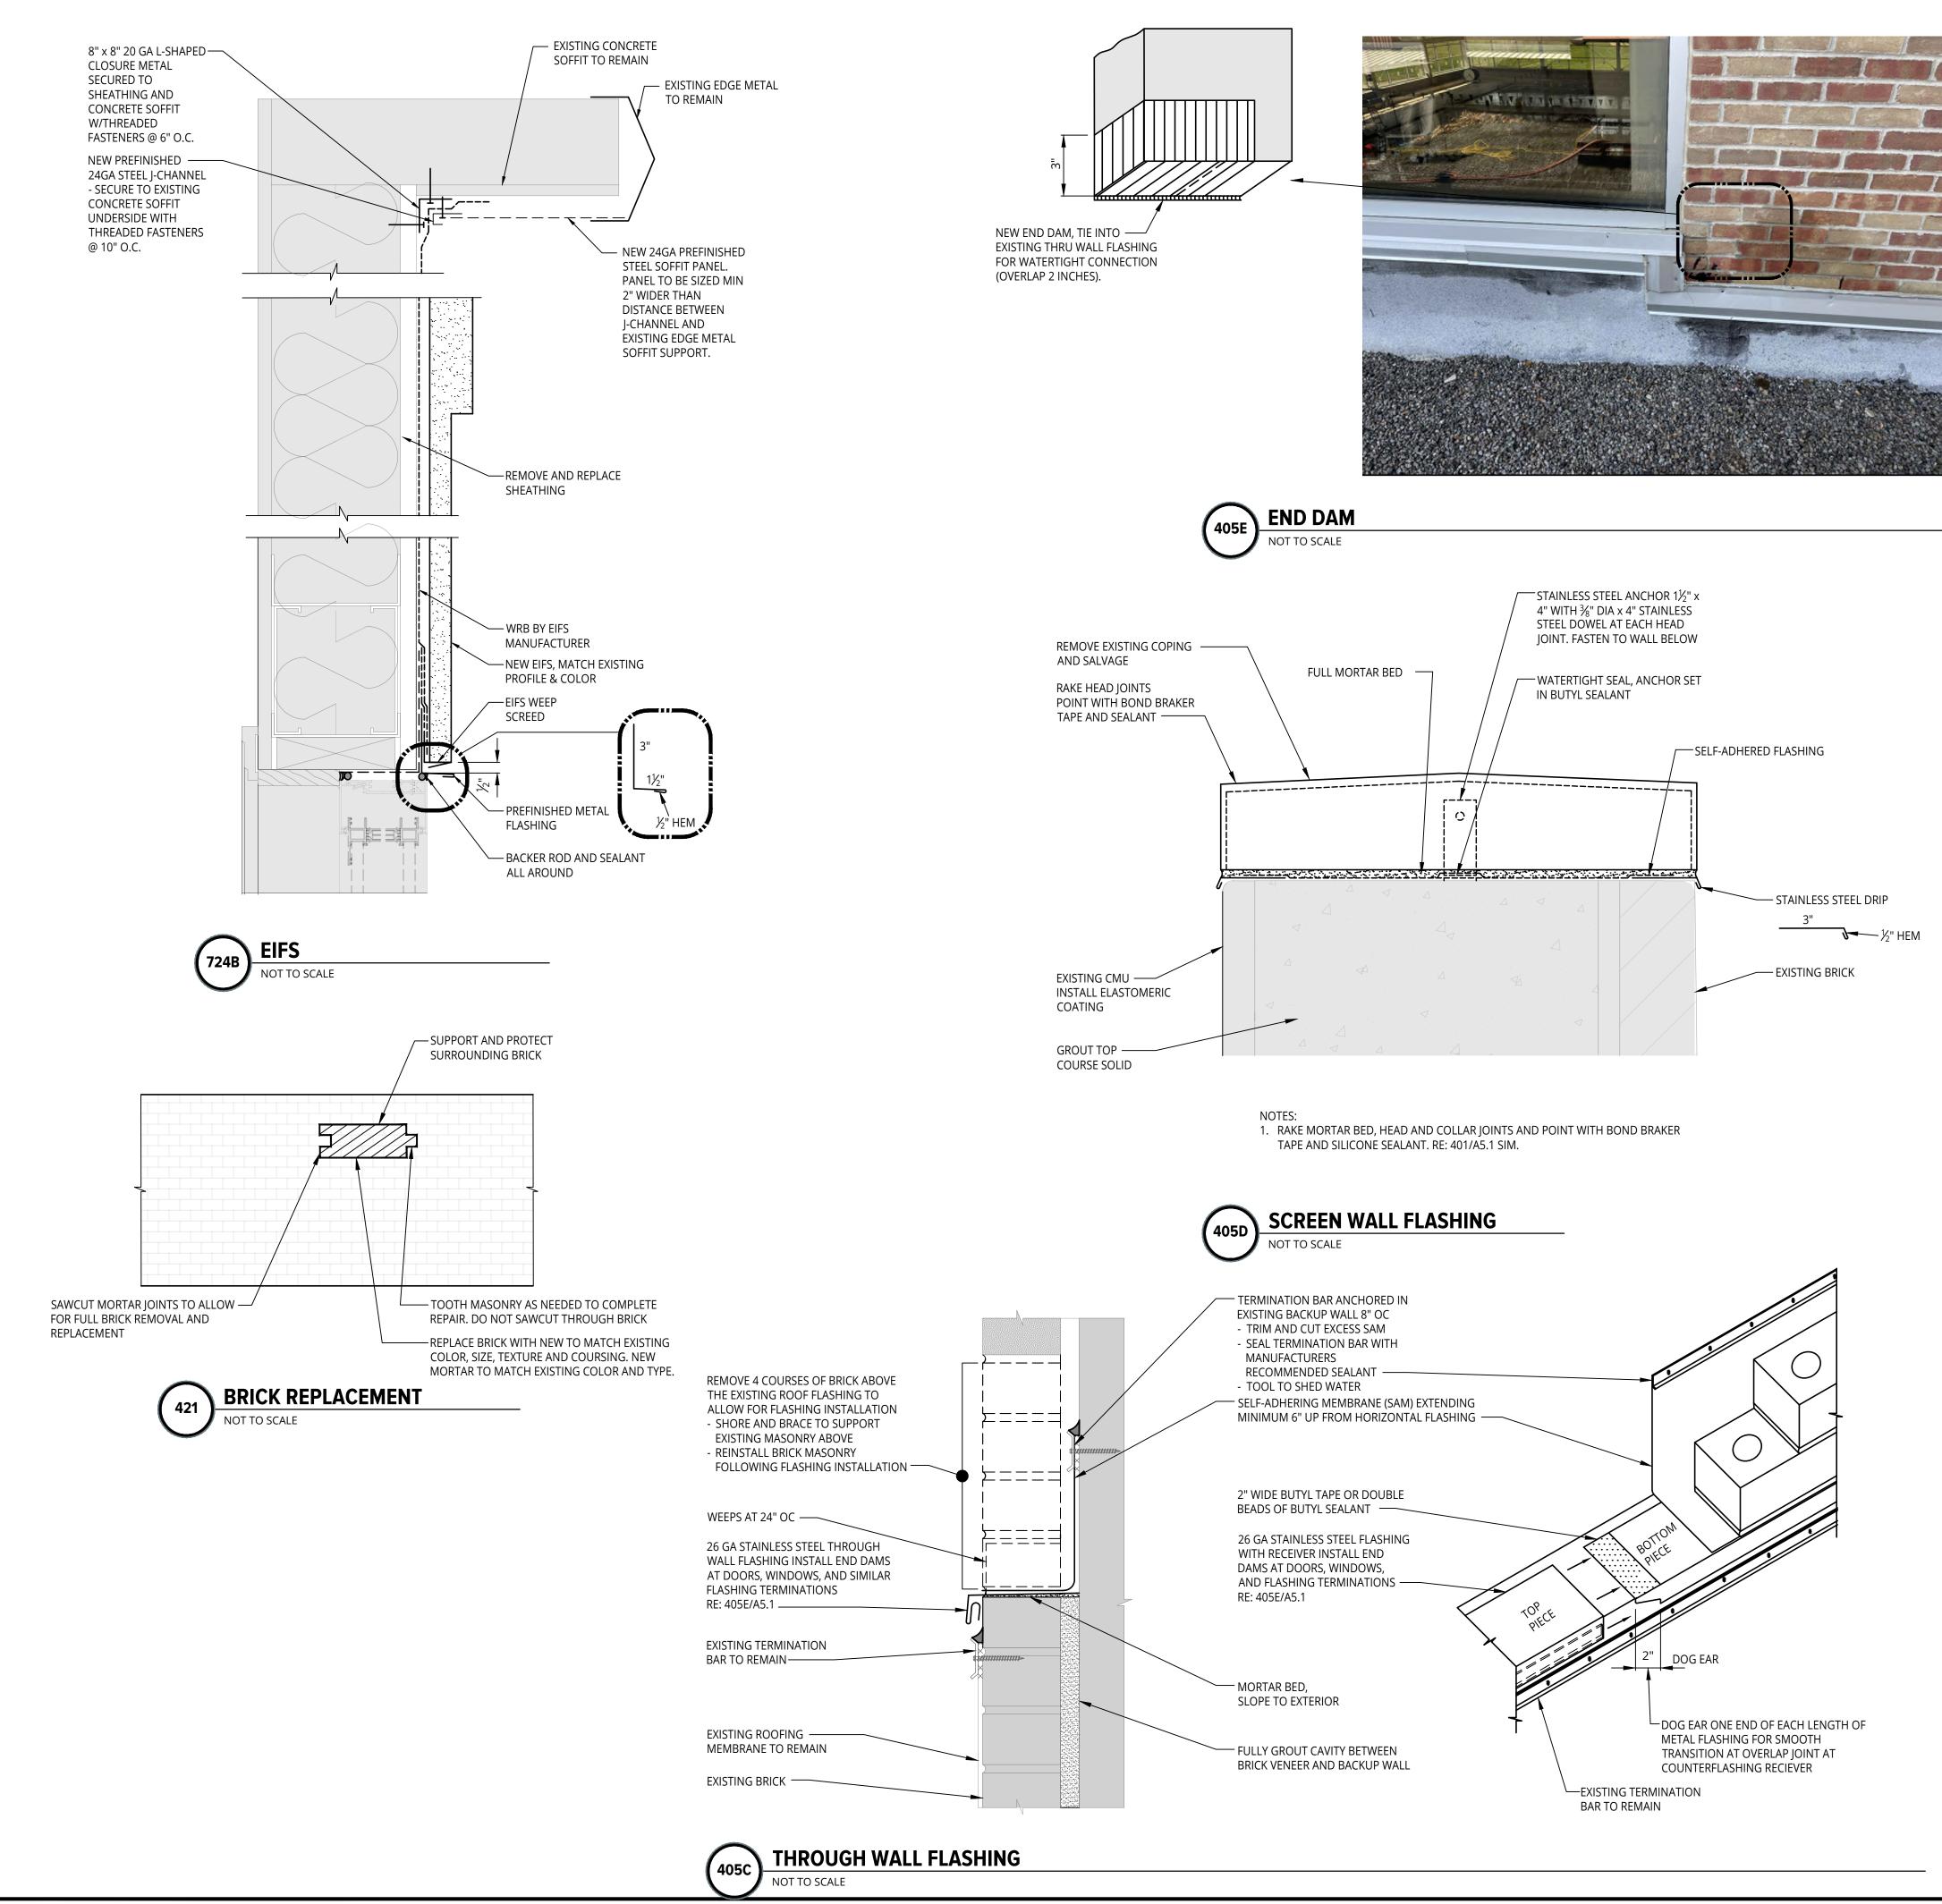



			Ε
GRIND HORIZONTAL REINFORCING AND REPOINT, DETAIL 405A/A5.1	Project WATERFORD SCH DISTRICT BUILDING ENCLO REPAIRS - 4 BUIL	SURE	
	Project Location WATERFORD TW	Р, М І	
GRIND HORIZONTAL REINFORCING & REPOINT NOT TO SCALE	Sheet Name DETAILS		
MORTAR LAYERS NOT TO EXCEED 1/4" EXISTING FACE BRICK TOOL FINISH LAYER TO MATCH EXISTING JOINT PROFILE EXISTING SOUND REMOVE <u>2 TO 21/2 x W</u> MINIMUM	Seal		
REPAIR NOTES: 1. CLEAN JOINT THOROUGHLY WITH JET OF WATER.	Revisions		
 DAMPEN JOINT TO SATURATED SURFACE DRY CONDITION PRIOR TO MORTAR APPLICATION. APPLY MORTAR IN LAYERS NOT EXCEEDING 1/4-INCH, PACK MORTAR WELL INTO JOINT CORNERS. 	OWNER REVIEW BID	12/22/23	TM KMD
 ALLOW EACH MORTAR LAYER TO REACH "THUMB-PRINT" HARDNESS PRIOR TO APPLYING THE NEXT LAYER. ADDIVISION ENVIRONMENT AND TOOL TO MATCH EXISTING JOINT PROFILE. 			
 APPLY FINAL MORTAR LAYER AND TOOL TO MATCH EXISTING JOINT PROFILE. PROVIDE MORTAR MATERIAL TO MATCH EXISTING MORTAR PROPORTION AND COLOR. 			
REMOVAL NOTES: 1. DO NOT REMOVE MORE THAN 1/2 SETTING BED DEPTH. 2. LEAVE SQUARE CORNER AT BACK OF CUT JOINT. 3. DO NOT DAMAGE BRICK DURING MORTAR REMOVAL.	, I		
405A REPOINTING NOT TO SCALE	SME Project No. 091744.0)0	
	Project Manager:		
SUBSTRATE	Designer:		
MORTAR/FIBER BOARD MORTAR AND INSTALL SEALANT MATCH EXISTING	CADD:		
JOINT WIDTH OR ¹ / ₂ " MAX	Checked By:		
TOOLED FINISH CONCAVE JOINT 3/16" RECESS	AKC Reviewed By:		
SUBSTRATE	JT Sheet No.		
NOTES: 1. ROUT AND REPOINT AS NEEDED PRIOR TO INSTALLATION OF SEALANT. 2. INSTALL SEALANT COLOR MOCK UP AREAS TO BE APPROVED BY OWNER.	Sheet No. A5.	I	
(401) (742) (792B) ROUT AND SEALED JOINT NOT TO SCALE	DRAWING NOTE: SCALE DEPICTED IS WILL SCALE INCORRECTLY IF PRIM MEDIA	ITED ON ANY OTHER SIZE	
	NO REPRODUCTION SHALL BE MA CONSENT OF © 2023	DE WITHOUT THE PRIOR SME	

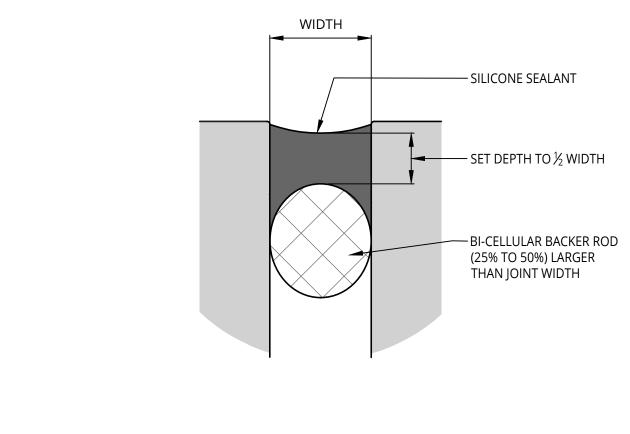





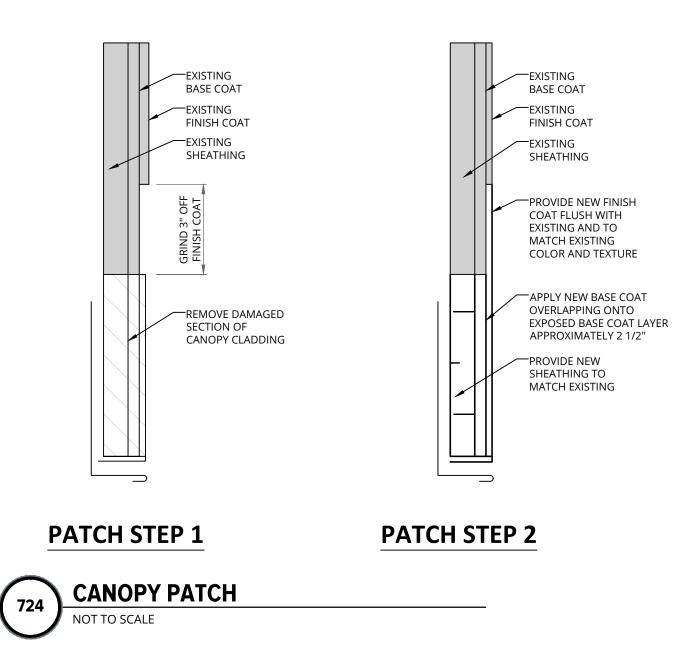

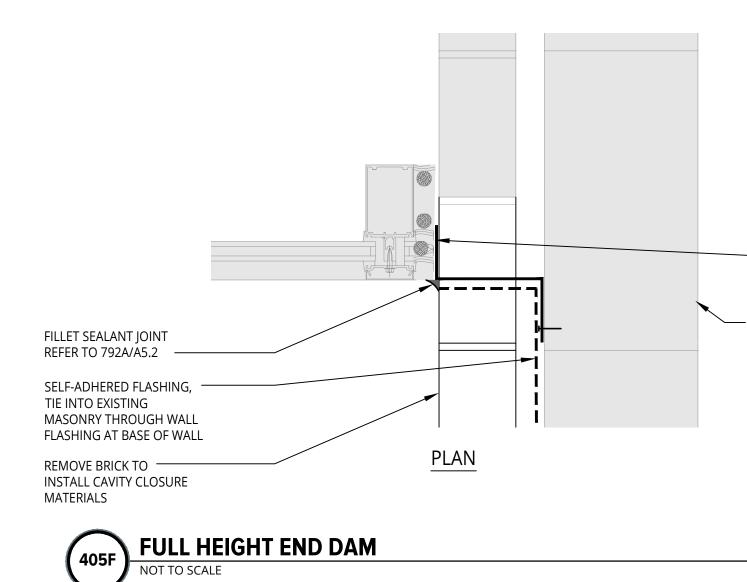

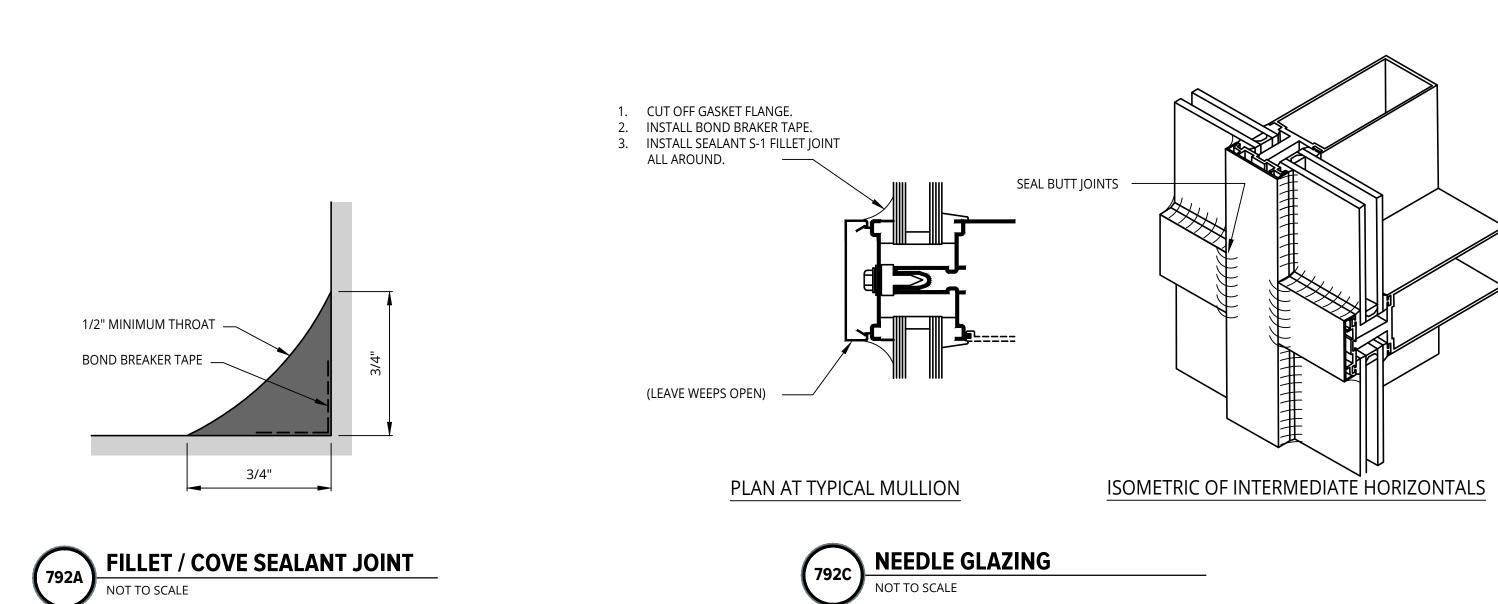


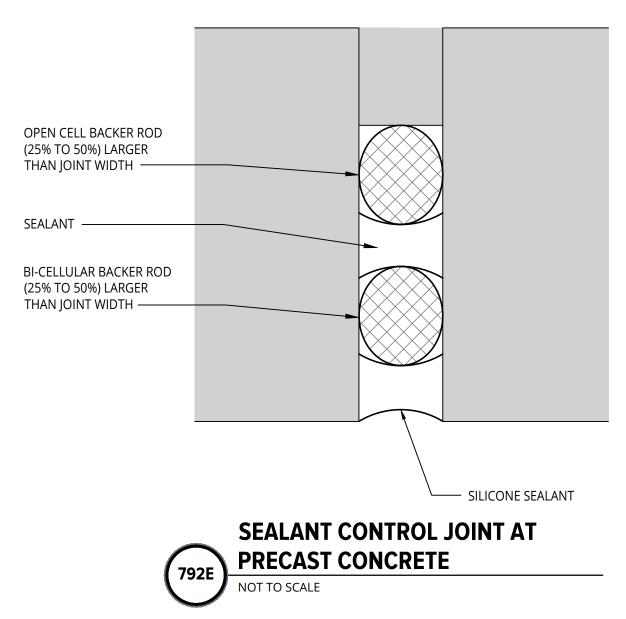

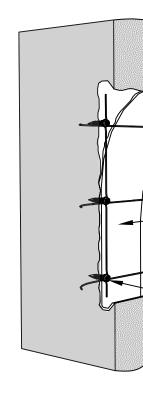

3D VIEW



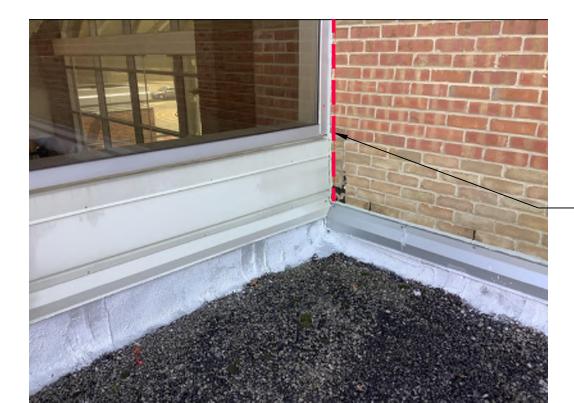


SAWCUT BRICK ENTIRE
 HEIGHT OF WALL AND
 REMOVE BRICK TO
 INSTALL CAVITY CLOSURE
 RE: PLAN



— SHEET METAL CLOSURE, FASTEN TO BACKUP WALL AT 12" O.C.

EXISTING BACKUP WALL

CLOSE-UP ELEVATION

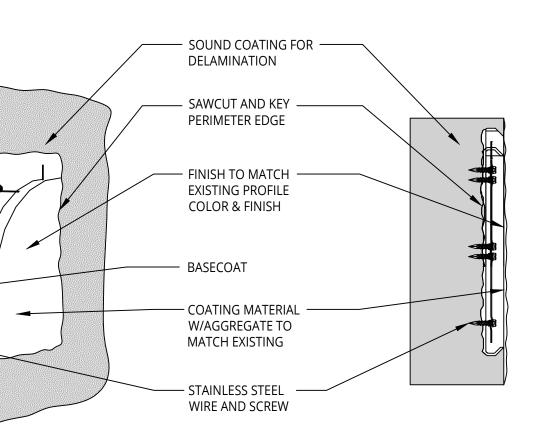

SECTION VIEW

AGGREGATE COATING REPAIR NOT TO SCALE

SME www.sme-usa.com					
Project					
WATERFORD SCH DISTRICT BUILDING ENCLO REPAIRS - 4 BUIL	SURE				
Project Location WATERFORD TW	P, MI				
Sheet Name DETAILS					
Seal					
Revisions					
OWNER REVIEW BID	12/22/23 1/16/24	TM KMD			
SME Project No.					
091744.0 Project Manager: AKC	00				
Designer:	Designer:				
CADD: BK					
Checked By: AKC					
Reviewed By: JT					
	Sheet No. A5.2				
WILL SCALE INCORRECTLY IF PRIM MEDIA NO REPRODUCTION SHALL BE MA	NO REPRODUCTION SHALL BE MADE WITHOUT THE PRIOR CONSENT OF SME				